

Chemical Quality of Surface Waters in Devils Lake Basin North Dakota, 1952-60

GEOLOGICAL SURVEY WATER-SUPPLY PAPER 1859-B

*Prepared as a part of a program of
the Department of the Interior for
Development of the Missouri River basin*



Chemical Quality of Surface Waters in Devils Lake Basin North Dakota, 1952-60

By HUGH T. MITTEN, C. H. SCOTT, and PHILIP G. ROSENE

CONTRIBUTIONS TO THE HYDROLOGY OF THE UNITED STATES

GEOLOGICAL SURVEY WATER-SUPPLY PAPER 1859-B

*Prepared as a part of a program of
the Department of the Interior for
Development of the Missouri River basin*



UNITED STATES DEPARTMENT OF THE INTERIOR

STEWART L. UDALL, *Secretary*

GEOLOGICAL SURVEY

William T. Pecora, *Director*

CONTENTS

| | Page |
|--|------|
| Abstract..... | B1 |
| Introduction..... | 2 |
| Devils Lake drainage basin..... | 4 |
| Climate..... | 5 |
| Fluctuations of Devils Lake..... | 5 |
| Hydrology..... | 5 |
| Inflow and outflow at Devils Lake..... | 9 |
| Chemical quality of the water..... | 14 |
| Big Coulee..... | 15 |
| Devils Lake and bays..... | 16 |
| East Devils Lake..... | 21 |
| Eastern and western Stump Lakes..... | 22 |
| Trace elements and radioactivity in the water..... | 26 |
| Miscellaneous surface waters..... | 29 |
| Salts in the beds and shores of the major lakes..... | 32 |
| Effect of lake levels on the quality of water..... | 40 |
| Summary..... | 40 |
| Literature cited..... | 42 |

ILLUSTRATIONS

| | Page |
|---|-----------|
| PLATE 1. Map showing location of sampling sites..... | In pocket |
| FIGURE 1. Graph showing water-surface altitudes of Devils Lake, 1952-60..... | B6 |
| 2. Graph showing annual precipitation during 1901-60 at the city of Devils Lake..... | 6 |
| 3. Flow-duration curve, Big Coulee near Churchs Ferry..... | 10 |
| 4. Graph showing approximate annual mean water-surface altitudes of Devils Lake and nearby well..... | 13 |
| 5. Graphs showing percentage of equivalents per million of the major constituents in the water of Big Coulee..... | 17 |
| 6. Diagram showing average percentage of equivalents per million of the major constituents in the water of the Devils Lake chain..... | 24 |
| 7. Photograph showing salt bars in eastern Stump Lake and salt deposits along the edge of the water..... | 25 |
| 8. Photograph of salt crystals at the edge of the water, eastern Stump Lake..... | 25 |
| 9. Graph showing volume of water and concentration of dissolved solids in the water in Devils Lake, 1949-60..... | 34 |

TABLES

| | Page |
|---|------|
| TABLE 1. Temperature variations in lakes..... | B7 |
| 2. Water-budget computations, Devils Lake..... | 11 |
| 3. Selected chemical analyses of water in Big Coulee..... | 14 |
| 4-6. Chemical analyses of water in— | |
| 4. Devils Lake and bays..... | 18 |
| 5. East Devils Lake..... | 22 |
| 6. Stump Lake..... | 26 |
| 7. Observed radiochemical data and concentration of some trace elements..... | 28 |
| 8. Chemical analyses of miscellaneous surface-water samples in Devils Lake basin, June 1954 to May 1960..... | 30 |
| 9. Yearly salt balances for Devils Lake, including Sixmile Bay and Creel Bay..... | 36 |
| 10. Estimated salt balances for East Devils and western and eastern Stump Lakes, May 1952 to September 1960..... | 37 |
| 11. Weight of salts available from bed and shore material..... | 38 |

CONTRIBUTIONS TO THE HYDROLOGY OF THE UNITED STATES

CHEMICAL QUALITY OF SURFACE WATERS IN DEVILS LAKE BASIN, NORTH DAKOTA, 1952-60

By HUGH T. MITTEN, C. H. SCOTT, and PHILIP G. ROSENE

ABSTRACT

Above-normal precipitation in 1954, 1956, and 1957 caused the water surface of Devils Lake to rise to an altitude of 1,419.3 feet, its highest in 40 years. Nearly all the water entering the lake flowed through Big Coulee, and about three-fourths of that inflow was at rates greater than 100 cubic feet per second. At these rates, the inflow contained less than 600 ppm (parts per million) dissolved solids and was of the calcium bicarbonate type.

Because the inflow was more dilute than the lake water, the dissolved solids in the lake decreased from 8,680 ppm in 1952 to about 6,000 ppm in 1956 and 1957. Subsequently, however, they increased to slightly more than 8,000 ppm and averaged 6,800 ppm for the 1954-60 period. Sodium and sulfate were the principal dissolved constituents in the lake water. Although the concentration of dissolved solids varied significantly from time to time, the relative proportions of the chief constituents remained nearly the same.

Water flowed from Devils Lake to Mission Bay in 1956, 1957, and 1958, and some flowed from Mission Bay into East Bay. However, no water moved between East Devils Lake, western Stump Lake, and eastern Stump Lake during 1952-60; these lakes received only local runoff, and the variations in their water volume caused only minor variations in dissolved solids. For the periods sampled, concentrations averaged 60,700 ppm for East Devils Lake, 23,100 ppm for western Stump Lake, and 127,000 ppm for eastern Stump Lake.

Sodium and sulfate were the chief dissolved constituents in all the lakes of the Devils Lake chain. Water in eastern Stump Lake was saturated with sodium sulfate and precipitated large quantities of granular, hydrated sodium sulfate crystals on the lakebed and shore in fall and winter. A discontinuous layer of consolidated sodium sulfate crystals formed a significant part of the bed throughout the year.

Measured concentrations of zinc, iron, manganese, fluoride, arsenic, boron, copper, and lead were not high enough to harm fish. Data on alpha and beta particle activities in Devils Lake were insufficient to determine if present activities are less than, equal to, or more than activities before nuclear tests began.

Miscellaneous surface waters not in the Devils Lake chain contained dissolved solids that ranged from 239 to 61,200 ppm. The lakes that spill infrequently and

have little or no ground-water inflow and outflow generally contain high concentrations of dissolved solids.

Salt balance computations for Devils Lake for 1952-60 indicate that a net of as much as 89,000 tons of salts was removed from the bed by the water in some years and as much as 35,000 tons was added to the bed in other years. For the 9-year period, the tons removed exceeded the tons added; the net removed averaged 2.7 tons per acre per year. Pickup of these salts from the bed increased the dissolved solids in the lake water an average of 193 ppm per year. Between 1952 and 1960, 201,000 tons of salt was added to the bed of East Devils Lake, 15,100 tons to the bed of western Stump Lake, and 421,000 tons to the bed of eastern Stump Lake.

Laboratory examination of shore and bed material indicated that the shore contained less weight of salt per unit weight of dry, inorganic material than the bed. Calcium and bicarbonate were the chief constituents dissolved from bed material of Devils Lake, whereas sodium and sulfate were the chief constituents dissolved from bed material of East Bay, East Devils Lake, and eastern and western Stump Lakes. Generally, calcium and bicarbonate were the chief constituents dissolved from shore material of all these lakes.

Evidence indicates that not more than 20 percent of the salt that "disappeared" from the water of Devils Lake west of State Route 20 as the lake altitudes decreased years ago will redissolve if the lake altitude is restored.

INTRODUCTION

Devils Lake basin is a large closed topographic basin in northeastern North Dakota. Devils Lake, the largest lake of the Devils Lake chain, was once the center of the most popular resort area in the State. In 1867, when the earliest authentic records of altitude were obtained, the level of this lake was at 1,438.3 feet. At that time the lake covered 90,000 acres and abounded in food and game fish. Between 1867 and 1940, the lake level declined, with only minor interruptions, and by 1940, the altitude had dropped to 1,400.9 feet. By then the lake had shrunk to a shallow, stagnant body of water that covered about 6,500 acres and supported only a few hardy fish. Throughout the next 20 years the lake level was somewhat higher than in 1940. It rose to a peak of 1,415.5 feet in 1951, declined to a low of 1,411.6 feet in 1954, rose to 1,419.3 feet in 1956, and declined to 1,415.1 feet in late 1960.

The loss of the area as a recreational center was felt throughout the State, but many people began to hope that Devils Lake would be restored as an attractive recreational asset when plans of the U.S. Department of the Interior for water-resources development in the Missouri River basin (U.S. Congress, 1944) included proposals to raise the water levels of the lakes in the Devils Lake chain and to provide a drainage outlet for them. After this restoration was proposed, several plans for diverting and restoring some or all of the lakes in the chain were considered by the U.S. Bureau of Reclamation (1961). Final plans for restoration have not been announced as of this writing (1966).

In late 1948 the U.S. Geological Survey began an investigation of Devils Lake basin to obtain information on water quality needed by the agencies formulating plans for restoration of the lakes. Results of the investigation from November 1948 to December 1952 were reported by Swenson and Colby (1955).

In their report Swenson and Colby (1955) compiled information on the fluctuations in the water-surface altitude of Devils Lake since 1867 and speculated on the reason for the general decline. They described the hydraulic relationships existing between the several lakes of the Devils Lake chain, gave the chemical characteristics of the water in the several lakes, and discussed the likely causes of the variations in the chemical characteristics from one lake to another.

They computed the tonnages of dissolved solids in water from Devils Lake and several other members of the lake chain from 1899 to 1952 and concluded that several millions of tons of dissolved solids disappeared from the water of Devils Lake between 1923 and 1948. The question then posed was whether this large quantity of salts will redissolve if the lake is restored to or above 1,416 feet, the altitude of Devils Lake in 1923.

Swenson and Colby prepared estimates of the probable concentrations and tonnages of dissolved solids in Devils Lake and in the other lakes downstream in the chain if the lakes are filled to an altitude of 1,425 feet. Assumptions had to be made regarding the quality of the water to be diverted into the lakes, the order in which the lakes are to be filled, the time to be allowed for filling, the drainage to be provided for the end-member of the lake chain, and other items. As the authors stated (p. 77), "The computed results should be understood as applicable only insofar as the assumptions may be good approximations of the actual quantities and hydrologic processes when and if the lakes are filled."

For several years following Swenson's and Colby's work in 1952, investigations of water quality in the Devils Lake basin continued but at a modest rate. Nevertheless, by 1960 considerable valuable additional information had been obtained not only on the chemical composition of water in numerous lakes in the basin but also on salts in the beds and shores of the major lakes.

The purposes of this report are to present the additional information obtained from 1952 to 1960 and to describe in more detail than was formerly possible some of the factors affecting the chemical quality of the surface waters in the basin, particularly water in the lakes of the Devils Lake chain.

This report is a supplement to the report of 1955 by Swenson and Colby. Where possible, additional information is presented in tables

and illustrations which, although differing somewhat in format from those in the earlier report, are actually continuations of them. Much of the new information, such as that on salt in the lakebeds and shores, has no counterpart in the earlier report. Also, no attempt is made in this report to predict the effects of different methods of lake restoration and subsequent operation on the quality of water in the major lakes or on the Sheyenne River into which drainage from the lakes would go. The current uncertainty as to the plan for restoration and the large number of choices or combination of choices make such a prediction somewhat futile at this time.

The names of two of the streams are different from the names published by Swenson and Colby (1955). The part of Mauvais Coulee that is downstream from Lake Irvine is called Big Coulee in this report to conform to a decision made in 1961 by the Board of Geographic Names (written commun.). Sweet Creek is called Edmore Coulee to conform to the name given in recent U.S. Geological Survey water-supply papers entitled "Surface Water Supply of the United States."

Edward Bradley of the U.S. Geological Survey furnished unpublished data on observation well levels, and H. M. Erskine, also of the U.S. Geological Survey, furnished unpublished data on outflow from Devils Lake. Acknowledgment is due R. L. Bagwell of the U.S. Fish and Wildlife Service for assistance in obtaining certain field measurements and samples, and Ernest Weed of the North Dakota Highway Department for information concerning a culvert installed between Mission and East Bays. Radiochemical analyses were made in Denver, Colo.; all other laboratory analyses were made in Lincoln, Nebr.

DEVILS LAKE DRAINAGE BASIN

Devils Lake basin includes about 3,800 square miles in northeastern North Dakota (pl. 1). It extends north from the hills between the Sheyenne River and Devils Lake to the Canadian boundary. The east and west boundaries of the basin are not distinct, but the basin extends roughly to State Route 30 on the west and to the headwaters of Edmore Coulee on the east.

The basin is in the Western lake section (Lemke, 1960, p. 6) of the Central Lowland physiographic province (Fenneman, 1938, p. 559-588). The topography of the basin is of glacial origin and is in a youthful stage of erosion. The surficial deposits of glacial drift that cover the area are of late Pleistocene age and were laid down by the Leeds lobe during the Mankato Stade of the Wisconsin Glaciation (Lemke, 1960, p. 42). Altitudes range from 1,600 to 1,900 feet in the northern part of the basin and from 1,380 to 1,660 feet in the southern part. The drainage is poorly developed and except for a few coulees is indistinct.

CLIMATE

The basin is in a region of temperate continental climate and has moderate rainfall (Simpson, 1929, p. 12), long rigorous winters, and warm summers. The relative humidity averages about 78 percent (Swenson and Colby, 1955, p. 7). The prevailing wind is from the northwest throughout the year; the wind velocity averages about 10 miles per hour. The mean annual temperature is between 36° and 42°F; January is the coldest month and July the warmest.

At the city of Devils Lake the annual precipitation for 60 years (1901-60) averaged 17.4 inches. Much of the precipitation occurs during the summer months, usually as thunderstorms. On the average, 75 percent of the annual precipitation falls from April to September. A more complete discussion of climate is given by Swenson and Colby (1955, p. 5-7).

FLUCTUATIONS OF DEVILS LAKE

Devils and Stump Lakes formerly drained into the Sheyenne River through Big Stoney spillway near Tolna, N. Dak. (Aronow, 1957, p. 412-414). The outlet was at an altitude of 1,453 feet—15 feet above the highest recorded level of Devils Lake and 38 feet above the level of Devils Lake in 1960. Aronow stated, however, that very little water probably flowed through the spillway in postglacial time because the bottom of Big Stoney spillway has not been cut below a nearly accordant junction of another glacial spillway tributary to it. Aronow also found evidence that declines similar to the one experienced since the late 1800's occurred at least one and possibly two or more times previously.

A knowledge of the recent history of Devils Lake will be valuable to those who are working on plans for restoration of the lakes in the chain; therefore, investigations have centered on the fluctuations of the lake level and on the brackish waters that result when the lake level declines. Records of water-surface altitudes are given by Swenson and Colby (1955), and additional records are available in the annual series of water-supply papers entitled "Surface Water Supply of the United States." The records of the altitudes for 1952-60 are shown in figure 1.

HYDROLOGY

Although data on the hydrology of the Devils Lake area are incomplete, several useful computations based on available and estimated data are presented.

Annual precipitation at Devils Lake during 1952-60 ranged from 10.83 inches in 1952 to 22.37 inches in 1954 (fig. 2). The average was about 17.1 inches, which is near the long-term average of 17.4 inches.

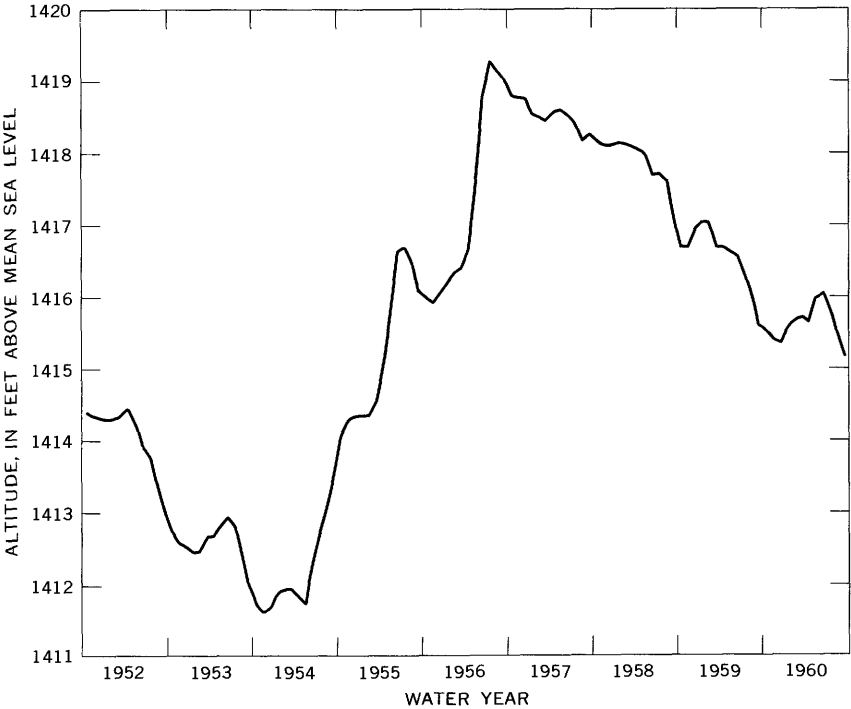


FIGURE 1.—Water-surface altitudes of Devils Lake, 1952-60.

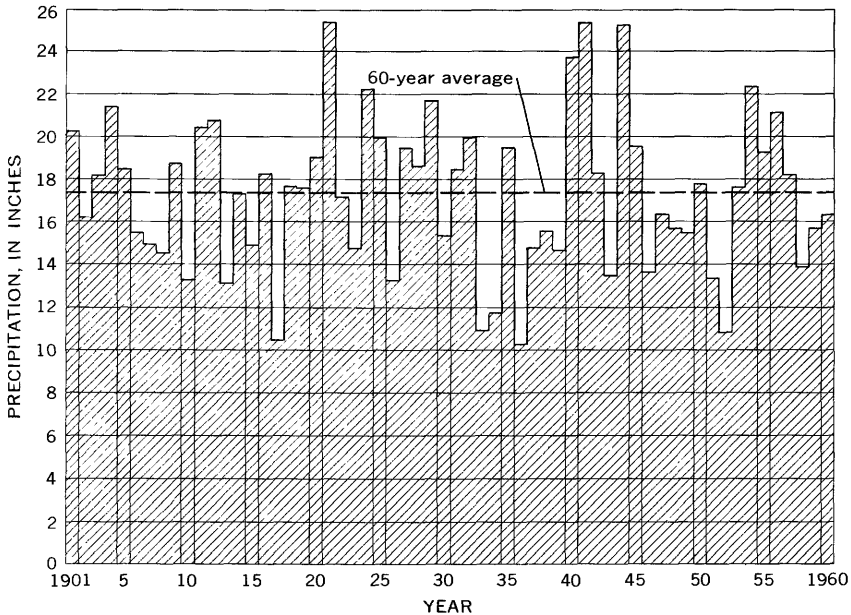


FIGURE 2.—Annual precipitation during 1901-60 at the city of Devils Lake.

A map prepared by the U.S. Weather Bureau (Kohler, Nordenson, and Baker, 1959) shows the average annual class-A pan evaporation to be about 40 inches at Devils Lake. The annual evaporation, based on seasonal class-A pan data, at the city of Devils Lake for the water years 1952-60 averaged about 37.6 inches. The seasonal pan data were converted to annual values on the basis of a map that shows the average evaporation for May to October to be about 85 percent of the annual evaporation. According to Kohler, Nordenson, and Baker (1959) the map can be applied only to shallow lakes where energy storage can be ignored. Energy storage from summer to winter is assumed to be insignificant in the Devils Lake chain because, at a given time, variation in temperature—either horizontal or vertical—is slight (table 1). On calm days the temperature of Devils Lake at the surface may rise above that at middepth and at the bottom, but wind action soon equalizes the temperature throughout the body of water. The class-A pan annual evaporation was converted to lake evaporation by use of an average pan coefficient of 75 percent.

TABLE 1.—*Temperature variations in lakes*

| Sampling site (see pl. 1) | Date | Depth (feet) | Air tem- perature (°F) | Lake temperature (°F) | | | Remarks |
|------------------------------|--------------|-----------------|------------------------------|-----------------------|----------|--------|---------|
| | | | | Surface | Middepth | Bottom | |
| Sixmile Bay | | | | | | | |
| 2..... | Oct. 5, 1959 | 3.1 | 54.8 | 52.0 | ----- | 52.0 | |
| 4..... | do..... | 3.8 | ----- | 50.1 | ----- | 50.2 | |
| 3..... | May 4, 1960 | 3.4 | 59 | 48 | ----- | 47 | |
| Creel Bay | | | | | | | |
| 19..... | Oct. 1, 1959 | ----- | 45.0 | 49.0 | ----- | 49.0 | Windy. |
| 21..... | do..... | 12.8 | 50.0 | 49.3 | ----- | 49.3 | Do. |
| 23..... | do..... | 8.5 | ----- | 48.0 | ----- | 48.0 | Do. |
| 24..... | do..... | 10.3 | 44.0 | 47.5 | ----- | 48.2 | Do. |
| 25..... | do..... | 9.9 | 45.5 | 48.2 | ----- | 48.1 | Do. |
| 26..... | do..... | 9.5 | 48.2 | 48.0 | ----- | 48.1 | Do. |
| 27..... | do..... | 8.1 | 45.0 | 48.2 | ----- | 48.0 | Do. |
| 30..... | do..... | 4.0 | 42.9 | 47.0 | ----- | 47.0 | Do. |
| 31..... | do..... | 7.2 | ----- | 47.3 | ----- | 47.3 | Do. |
| Main part of Devils Lake | | | | | | | |
| 13..... | Oct. 4, 1959 | 13.5 | 65.0 | 50.0 | 49.0 | 48.5 | Calm. |
| 14..... | do..... | 14.6 | ----- | 51.1 | 48.5 | 48.5 | Do. |
| 17..... | do..... | 15.2 | 62.8 | 52.5 | 49.0 | 49.0 | Do. |
| 20..... | do..... | 15.7 | ----- | 52.2 | 48.5 | 48.5 | Do. |
| 28..... | do..... | 15.4 | 60.6 | 54.0 | 48.7 | 48.5 | Do. |
| 29..... | do..... | 15.7 | 66.0 | 52.0 | 49.0 | 49.0 | Do. |
| 6..... | Oct. 5, 1959 | 7.4 | ----- | 48.8 | ----- | 49.8 | Windy. |
| 9..... | do..... | 14.8 | 49.0 | 48.8 | ----- | 48.8 | Do. |
| 10..... | do..... | ----- | 51.8 | 49.3 | ----- | 49.0 | Do. |
| 15..... | do..... | 15.7 | 49.1 | 49.2 | ----- | 48.0 | Do. |
| 33..... | do..... | 14.7 | ----- | 49.0 | ----- | 48.5 | Do. |
| 34..... | do..... | 13.0 | 46.6 | 48.5 | ----- | 48.5 | Do. |

TABLE 1.—*Temperature variations in lakes—Continued*

| Sampling site (see pl. 1) | Date | Depth (feet) | Air tem- perature (°F) | Lake temperature (°F) | | | Remarks |
|------------------------------|--------------|-----------------|------------------------------|-----------------------|----------|--------|---------|
| | | | | Surface | Middepth | Bottom | |
| Mission Bay | | | | | | | |
| 36----- | Oct. 2, 1959 | 5.7 | 51.0 | 44.2 | ----- | 44.2 | Windy. |
| 38----- | do----- | 5.4 | 50.0 | 44.5 | ----- | 44.5 | Do. |
| 39----- | do----- | 1.7 | 55.5 | 47.5 | ----- | ----- | Do. |
| 40----- | do----- | 5.3 | 53.0 | 44.5 | ----- | 44.5 | Do. |
| 41----- | do----- | 5.7 | 50.0 | 43.6 | ----- | 44.0 | Do. |
| 43----- | do----- | 5.7 | 45.8 | 44.0 | ----- | 43.0 | Do. |
| East Devils Lake | | | | | | | |
| 51----- | Oct. 3, 1959 | 2.8 | 65.0 | 49.0 | ----- | ----- | |
| 52----- | do----- | 2.1 | 59.5 | 49.5 | 50.0 | ----- | |
| 53----- | do----- | 3.8 | ----- | 48.5 | ----- | 48.5 | |
| 54----- | do----- | 2.5 | ----- | 48.2 | 48.0 | ----- | |
| 55----- | do----- | 4.3 | ----- | 47.5 | 47.5 | ----- | |
| 56----- | do----- | 4.9 | 59.2 | 47.5 | 47.5 | ----- | |
| 57----- | do----- | 4.3 | ----- | 48.0 | 48.0 | ----- | |
| Western Stump Lake | | | | | | | |
| 61----- | May 6, 1960 | 1.1 | ----- | 51.8 | ----- | ----- | Windy. |
| 62----- | do----- | 1.5 | ----- | 51.8 | ----- | ----- | Do. |
| 63----- | do----- | 1.2 | 50.0 | 51.8 | ----- | ----- | Do. |
| 64----- | do----- | .7 | 50.0 | 54.5 | ----- | ----- | Do. |
| Eastern Stump Lake | | | | | | | |
| 70----- | Oct. 9, 1959 | 2.7 | ----- | 39.0 | ----- | ----- | Windy. |
| 72----- | do----- | 3.8 | 32.0 | 40.0 | ----- | 39.5 | Do. |
| 74----- | do----- | 3.8 | 32.0 | 39.8 | ----- | 39.0 | Do. |
| 75----- | do----- | 4.3 | 32.8 | 39.5 | ----- | 39.0 | Do. |
| 76----- | do----- | 2.8 | ----- | 39.8 | ----- | ----- | Do. |
| 79----- | do----- | 1.5 | ----- | 38.0 | ----- | ----- | Do. |
| 80----- | do----- | .9 | 33.6 | 36.8 | ----- | ----- | Do. |
| 72----- | May 7, 1960 | 3.5 | ----- | 54.0 | ----- | 54.0 | Do. |
| 76----- | do----- | 2.9 | ----- | 54.0 | ----- | 54.0 | Do. |
| 80----- | do----- | 1.5 | ----- | 56.0 | ----- | 57.0 | Do. |

The water in the lakes of the basin is derived principally from precipitation on the lake surfaces and from surface runoff. The size of the area that contributes runoff to Devils Lake depends on the overflow of upstream lakes. About 400 square miles contributes drainage directly to Devils Lake. Runoff from another 400 square miles drains into Ibsen Lake, which probably overflows during most years because it has a surface area of only 1 or 2 square miles (Swenson and Colby, 1955). About 2,200 square miles contributes runoff to the lakes of the Sweetwater chain, which are fairly large and probably overflow only during relatively wet years. Thus, the effective drainage area of Devils Lake can range from about 400 to 3,000 square miles.

No attempt has been made in this investigation to correlate runoff with precipitation and temperature within the Devils Lake basin because the amount of drainage area is uncertain and runoff records

have not been kept for a sufficient length of time. Swenson and Colby (1955), however, analyzed records for the Sheyenne River upstream from Sheyenne, N. Dak., the drainage area of which is similar in topography, vegetation, soils, and climate to the Devils Lake drainage area. They found that a 1-inch decrease in annual precipitation may be associated with a decrease of runoff of about 0.03 or 0.04 inch per year and that an increase of 1° in average annual temperature may be associated with a decrease of runoff of about 0.08 or 0.09 inch per year.

Between May 1949 and September 1954, measurements of flow in Big Coulee were obtained only occasionally. Since October 1954, daily discharges have been computed for Big Coulee near Churchs Ferry, N. Dak. Flow duration of daily discharge (fig. 3) is based on flows for water years 1954 to 1960 excluding the largely estimated record of 1955. At discharges of less than about 300 cfs (cubic feet per second), flow duration is typical for ephemeral streams, but at discharges of more than 300 cfs, flow duration is altered by regulation from upstream lakes.

The gaged flow at Churchs Ferry may not be representative of the flow that enters Devils Lake even though there is little inflow between the gage and the lake. The large marshy area between the gage and the lake can store an appreciable amount of water. Flow estimated at about 20 cfs has been observed near the inlet of Big Coulee to Devils Lake when little or no flow was observed at the gaging station. Evapotranspiration from the marshy area is probably significant at times.

INFLOW AND OUTFLOW AT DEVILS LAKE

Water-budget calculations were made for Devils Lake for water years 1952-60 to determine the approximate annual volumes of water contributed to Devils Lake by precipitation on the lake surface and by surface runoff that enters through Big Coulee and the annual volumes of water lost from the lake by evaporation and outflow (table 2). The water-budget calculations are approximations because the precipitation data and class-A pan evaporation data, converted to annual lake evaporation by use of average coefficients, may not be representative of actual conditions existing over the lake. Also, small channels, other than Big Coulee, may contribute surface inflow from an area of 300-400 square miles (Swenson and Colby, 1955). For the purposes of calculation, the years were divided into periods; therefore, the net evaporation volumes shown in the table may not correspond exactly to the volume calculated from the annual precipitation and evaporation and the mean areas. Also, the stage-capacity and stage-area data used by Swenson and Colby (1955) differ from those

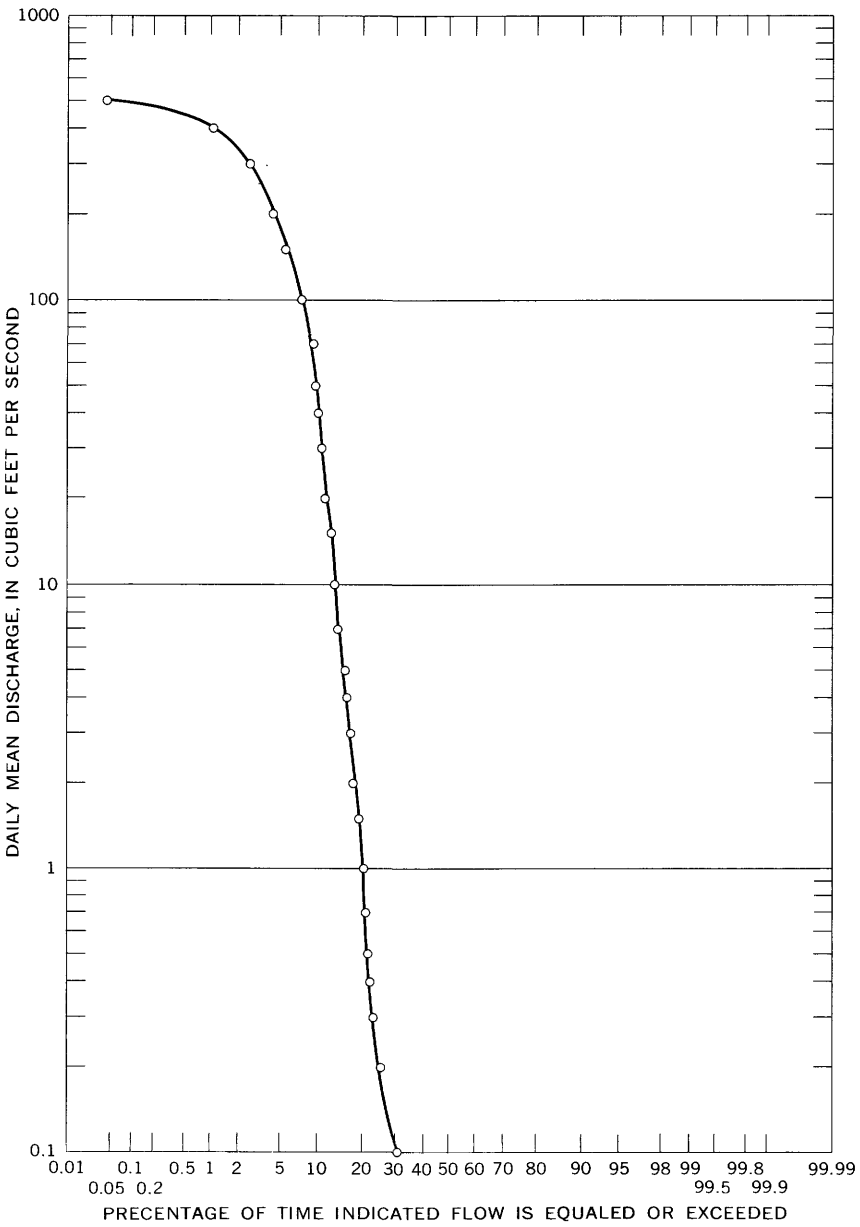


FIGURE 3.—Flow-duration curve, Big Coulee near Churches Ferry.

TABLE 2.—*Water-budget computations, Devils Lake*

| Water year | Inflow from Big Coulee (1,000 acre-ft) | Precip- itation (inches) | Lake evapo- ration (inches) | Mean area (1,000 acres) | Net evapo- ration volume (1,000 acre-ft) | Initial altitude (feet) | Initial volume (1,000 acre-ft) | Final altitude (feet) | Final volume (1,000 acre-ft) | Lake volume differ- ence (1,000 acre-ft) | Water- budget outflow (1,000 acre-ft) | Estimat- ed out- flow (1,000 acre-ft) |
|---------------|---|--------------------------------|--------------------------------------|----------------------------------|---|-------------------------------|---|-----------------------------|---------------------------------------|---|---|---|
| 1952..... | 0.006 | 11.27 | 34.76 | 15.3 | 26.9 | 1,414.45 | 156.6 | 1,412.94 | 135.2 | -21.4 | -8.5 | 0 |
| 1953..... | 0 | 16.27 | 28.93 | 13.9 | 14.6 | 1,412.94 | 135.2 | 1,411.83 | 119.6 | -15.6 | 1.0 | 0 |
| 1954..... | 34.3 | 23.18 | 24.33 | 13.7 | 1.4 | 1,411.83 | 119.6 | 1,413.90 | 148.6 | 29.0 | 3.9 | 0 |
| 1955..... | 42.4 | 16.71 | 29.01 | 17.0 | 17.8 | 1,413.90 | 148.6 | 1,416.05 | 182.8 | 34.2 | -9.6 | 0 |
| 1956..... | 57.2 | 21.17 | 25.39 | 18.1 | 6.7 | 1,416.05 | 182.8 | 1,418.95 | 233.9 | 51.1 | -6 | 19 |
| 1957..... | .95 | 19.32 | 25.20 | 18.3 | 9.2 | 1,418.95 | 233.9 | 1,418.17 | 219.0 | -14.9 | 6.8 | 18 |
| 1958..... | .06 | 12.98 | 28.16 | 18.0 | 22.9 | 1,418.17 | 219.0 | 1,416.85 | 195.6 | -23.4 | .6 | .6 |
| 1959..... | .07 | 15.17 | 29.24 | 17.3 | 20.3 | 1,416.85 | 195.6 | 1,415.50 | 173.5 | -22.1 | 1.9 | 0 |
| 1960..... | .28 | 17.92 | 28.71 | 16.9 | 15.2 | 1,415.50 | 173.5 | 1,414.90 | 163.4 | -10.1 | -4.8 | 0 |

¹ Computed by indirect methods from watermarks in culvert and estimated altitude of Mission Bay.

used in this report. The differences are small, however, and differences in storage changes are negligible. For the water years 1952, 1955, and 1960, the fairly large negative values for the calculated water-budget outflows probably are caused by calculated lake-evaporation values that are higher than those that actually existed at the lake. An evaporation of 31.8 inches at Devils Lake during the 1952 water year was estimated by Swenson and Colby (1955) from class-A pan data at Dickinson and Mandan and from average annual lake evaporation (Horton, 1943) at Devils Lake. A value of 34.8 inches was calculated from data of Kohler, Nordenson, and Baker (1959) and from class-A pan data at the city of Devils Lake. Part of the error in the 1955 calculations may be due to errors in estimated inflow from Big Coulee for 1955.

Surface-water outflow was zero for 1952-55. With the rise of water level in 1956, State Route 57 across the narrows between Devils Lake and Mission Bay was threatened with inundation. To protect the road the Highway Department, in late June, installed a culvert under State Route 20 to allow water to flow from Mission Bay into East Bay. The culvert was placed so that the spill altitude was below the water surface, and outflow began about the 1st of July and continued until sometime in 1958. Because the water-budget calculation for the 1956 water year was unreasonable, an estimated outflow was calculated by indirect methods based on the dimensions of the outflow culvert, the high water-marks in the culvert, and the estimated altitudes of Mission Bay. The calculation was based on fairly reliable estimates of water-surface altitudes and, therefore, is probably a fair estimate of the outflow for that year. The indirect calculations for the 1957 water year were based on estimates of altitudes of Mission Bay from Devils Lake altitudes. These estimates are not very reliable because the difference in altitudes between Mission Bay and Devils Lake increased as the water surface fell and no clearly defined watermarks were left in the culvert at the lower levels. In September 1956, the outflow from Devils Lake to Mission Bay was estimated to be 20 cfs. The lake level was decreasing during the 1957 water year, but if the average discharge from Devils Lake is assumed to be 20 cfs, then the outflow for the year would have been about 14,000 acre-feet compared with the 18,000 acre-feet computed by the indirect method. The actual volume of outflow for the 1957 water year probably lies between the indirect and the water-budget calculations.

The fluctuations of the average altitude of the surface of Devils Lake for the years 1938-60 follow rather closely the fluctuations of the average water level in a well, in glacial drift, about half a mile north of Devils Lake between Sixmile and Creel Bays; the similar fluctuations (fig. 4) indicate a possible hydraulic connection between lake and ground-water reservoir. The lakes of the Devils Lake chain

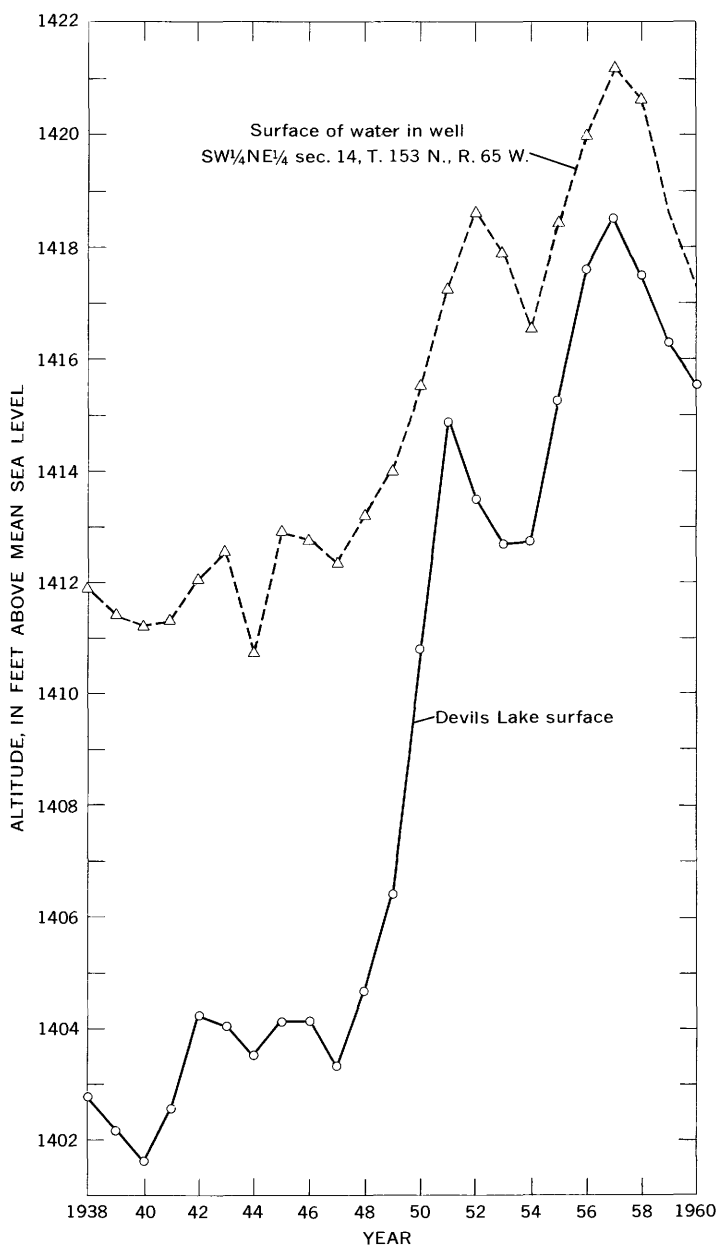


FIGURE 4.—Approximate annual mean water-surface altitudes of Devils Lake and nearby well.

TABLE 3.—*Selected chemical*

[Results in parts per

| Date of collection | Discharge (cfs) | Temperature (°F) | Silica (SiO ₂) | Iron (Fe) | Manganese (Mn) | Calcium (Ca) | Magnesium (Mg) | Sodium (Na) | Potassium (K) |
|---|------------------|------------------|----------------------------|-------------------|----------------|--------------|----------------|-------------|---------------|
| Near Churchs Ferry | | | | | | | | | |
| July 20, 1954..... | 268 | ----- | ----- | ----- | ----- | 44 | 18 | 29 | ----- |
| May 3, 1956..... | 546 | ----- | 11 | ¹ 0.07 | ----- | 33 | 14 | 20 | 8.0 |
| May 28, 1959..... | .02 | ----- | ----- | ----- | ----- | 288 | 161 | 407 | ----- |
| Near Grahams Island (sampling site 1 on pl. 1) | | | | | | | | | |
| June 26, 1955..... | ² 150 | ----- | ----- | ----- | ----- | 62 | 35 | 68 | ----- |
| Sept. 23, 1955..... | ² 15 | ----- | 38 | ¹ 0.14 | ----- | 65 | 49 | 108 | 35 |
| Sept. 23, 1956..... | ² 15 | ----- | ----- | ----- | ----- | ----- | ----- | 83 | ----- |
| Apr. 28, 1957..... | ² 12 | 60 | 8.2 | ¹ 0.04 | ----- | 53 | 37 | 86 | 26 |
| Oct. 4, 1957..... | ² 10 | 55 | 7.9 | ¹ 0.08 | ----- | 63 | 87 | 360 | 61 |
| June 22, 1958..... | ² 5 | 73 | 11 | ¹ 0.17 | ----- | 78 | 232 | 1,070 | 70 |
| May 4, 1960..... | ² 20 | 48 | 21 | .12 | 0.00 | 81 | 45 | 90 | 32 |

¹ In solution when analyzed.² Estimated.

probably receive ground water; Paulson and Akin (1964, p. 51) showed that some ground water moves northward toward the Devils Lake chain from outwash deposits to the south. Because lake deposits and lake-modified glacial drift composed of laminated clay and silt underlie the lakes in the chain and because these deposits are in turn underlain by boulder clay and glacial till, ground-water movement probably is slow; therefore, no allowance is made for ground-water movement or bank storage in the water-budget calculations. The error introduced by neglecting these factors probably is less than the errors introduced in estimates of the volume of water evaporated from the lake. The estimates of volumes of outflow, although somewhat crude, are suitable for use in estimating the tonnage of salt lost by outflow in the salt-balance computations that will be given later in this report.

CHEMICAL QUALITY OF THE WATER

Generally in the runoff into Devils Lake, calcium, magnesium, and bicarbonate ions are highest in concentration and sodium and sulfate ions are next highest. As the dissolved solids are concentrated by evaporation, the solubility of the alkaline-earth carbonates is exceeded, and these ions precipitate; thus, the water stored in the lakes is of the sodium sulfate type.

analyses of water in Big Coulee

million except as indicated]

| Bicar- bonate (HCO ₃) | Car- bonate (CO ₃) | Sul- fate (SO ₄) | Chlo- ride (Cl) | Fluo- ride (F) | Ni- trate (NO ₃) | Boron (B) | Dissolved solids | | Hard- ness as CaCO ₃ | Specific conduct- ance (micro- mhos per cm at 25°C) | pH |
|--|--------------------------------------|------------------------------------|-----------------------|----------------------|------------------------------------|--------------|------------------|---------------------|--|---|-----|
| | | | | | | | Calcu- lated | Residue at 180°C | | | |
| Near Churchs Ferry—Continued | | | | | | | | | | | |
| 213 | 0 | 60 | 16 | | | | | 319 | 184 | 490 | 7.4 |
| 122 | 0 | 68 | 8.5 | 0.0 | 7.8 | 0.05 | | 248 | 139 | 381 | 7.6 |
| 277 | 0 | 1,780 | 170 | | | | | 3,220 | 1,380 | 3,660 | 7.5 |
| Near Grahams Island (sampling site 1 on pl. 1)—Continued | | | | | | | | | | | |
| 314 | 14 | 146 | 25 | | | 0.17 | | 556 | 298 | 837 | 8.5 |
| 444 | 0 | 195 | 58 | 0.6 | 1.2 | .10 | | 762 | 365 | 1,380 | 8.0 |
| 350 | 6 | 168 | | | | | | 652 | 324 | 1,020 | 8.4 |
| 270 | 0 | 195 | 43 | .1 | .4 | .11 | | 608 | 284 | 918 | 8.1 |
| 388 | 0 | 776 | 195 | .2 | 1.5 | .27 | 1,740 | 1,780 | 515 | 2,560 | 8.1 |
| 498 | 40 | 2,380 | 527 | .3 | .9 | .85 | 4,660 | 4,850 | 1,150 | 6,250 | 8.6 |
| 233 | 0 | 351 | 48 | .3 | 1.2 | .25 | | 847 | 387 | 1,190 | 7.3 |

BIG COULEE

Mauvais Coulee, which becomes Big Coulee below Lake Irvine, is an intermittent stream; it heads near the international boundary and drains nearly the entire basin. This coulee trends south and joins Edmore Coulee, which drains the Sweetwater chain of lakes, in Lac Aux Mortes. Little Coulee drains the western part of the basin and discharges water into Big Coulee. Big Coulee flows into Devils Lake at the southern end of Sixmile Bay (pl. 1) and prior to the general decline of lake levels in the region it discharged a large amount of water into the lake.

The observed dissolved-solids content in Big Coulee from 1954 to 1960 averaged about 550 ppm near Churchs Ferry and 1,400 ppm near Grahams Island. Table 3 shows selected analyses of water in Big Coulee; additional data are published in the annual series of U.S. Geological Survey water-supply papers entitled "Quality of Surface Waters of the United States, Parts 5 and 6." The general increase in dissolved solids between Churchs Ferry and Grahams Island was probably caused by evapotranspiration in the large swampy area west of Devils Lake. The increase had practically no effect on the chemical quality of the water in Devils Lake because the highest concentrations were observed during very low flow periods when the total quantities of salt transported to the lake were small.

The type of water that flows in Big Coulee is related to discharge. The water near Churchs Ferry is of the sodium sulfate type when the discharge is about 0.1 cfs and is of the calcium bicarbonate type when the discharge is about 1 cfs or greater (fig. 5). The water near Grahams Island is of the sodium sulfate type when the discharge is about 10 cfs and is of the calcium bicarbonate type when the discharge is about 100 cfs. During 1954-60, about 76 percent of the discharge from Big Coulee was 100 cfs or more; therefore, most of the water that entered Devils Lake from Big Coulee probably was of the calcium bicarbonate type and probably contained less than 600 ppm of dissolved solids.

DEVILS LAKE AND BAYS

From 1954 to 1960, the observed dissolved solids in water from Devils Lake and its bays averaged about 6,500 ppm for Sixmile Bay, 6,000 ppm for Creel Bay, 6,800 ppm for the main part of Devils Lake, 11,500 ppm for Mission Bay, and 8,300 ppm for East Bay. (See table 4.) The free movement of water between Sixmile Bay, the main part of Devils Lake, and Creel Bay causes the concentrations of dissolved solids to be similar. The dissolved solids seemingly were relatively low in Devils Lake, Creel Bay, and Sixmile Bay in April 1955; probably, however, the samples taken were not representative of all the lake water because runoff from an exceptionally large amount of snow and ice melt had not mixed thoroughly with the rest of the water. The volume of water in Devils Lake increased from 1954 to 1956 (table 2) because runoff into the lake exceeded evaporation. Also, because the runoff contained less dissolved solids than the lake water already present, the dissolved solids in the lake decreased. From 1956 to 1960, evaporation exceeded runoff into the lake, the lake volume decreased, and the dissolved solids increased. The dissolved solids in water from Devils Lake, reported as 8,680 ppm in 1952 by Swenson and Colby (1955, p. 61), decreased to about 6,000 ppm in 1956 and 1957 and subsequently increased to more than 8,000 ppm.

Two 36-inch round corrugated metal culverts through the roadbed of State Route 57 connect Mission Bay and the main part of Devils Lake. The spill altitude of the culverts is about 1,416.1 feet. Because water does not move freely from the main part of Devils Lake into Mission Bay and because evaporation exceeds inflow, the average concentration of dissolved solids was higher in water of Mission Bay than in water of Sixmile Bay, Creel Bay, or the main part of Devils Lake.

The outlet from Mission Bay to East Bay is a 5-foot round corrugated metal culvert through the roadbed of State Route 20. The spill altitude of the culvert is about 1,416.2 feet. No coulees drain into

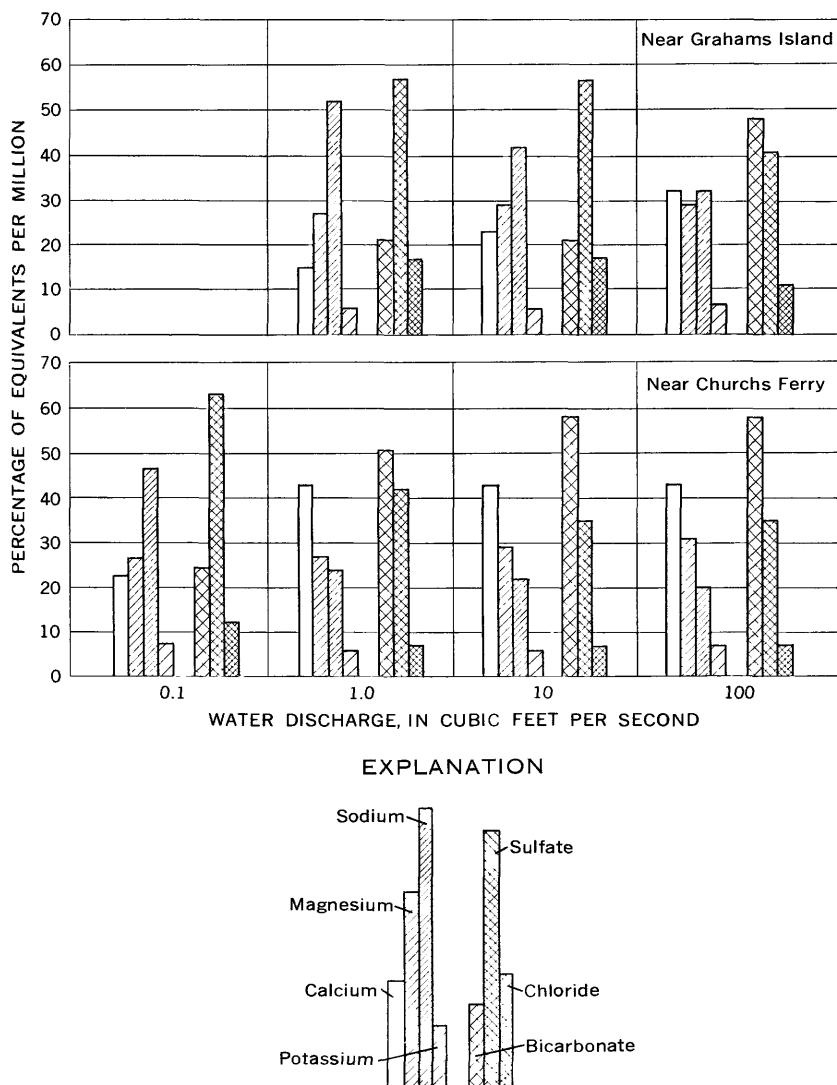


FIGURE 5.—Percentage of equivalents per million of the major constituents in the water of Big Coulee.

East Bay ; therefore, the water in East Bay is almost entirely precipitation that falls on or near it and overflow from Mission Bay. The average dissolved solids for East Bay was based on only three samples of water from isolated pools. These samples showed that dissolved solids were less than in Mission Bay. The lesser concentration of dissolved solids in East Bay indicates that precipitation is probably the source of most of the water in the bay. However, East Bay is dry most of the time and part of the salt that is deposited on the bed of East Bay is

TABLE 4.—*Chemical analyses*

[Results in parts per mil]

| Sampling site (see pl. 1) | Date of collection | Lake altitude (feet) | Tem- per- ature (° F.) | Silica (SiO ₂) | Iron (Fe) | Man- ganese (Mn) | Cal- cium (Ca) | Mag- nesium (Mg) | Sodium (Na) | Potas- sium (K) |
|---------------------------------|----------------------------|----------------------------|---------------------------------|-------------------------------|--------------|------------------------|----------------------|------------------------|----------------|-----------------------|
| Sixmile Bay | | | | | | | | | | |
| 5----- | June 26, 1955 | ----- | 66 | ----- | ----- | ----- | ----- | ----- | 414 | ----- |
| 2----- | Oct. 5, 1959 | 1,415.44 | 52 | 20 | 0.09 | ----- | 78 | 376 | 1,990 | 231 |
| 3----- | May 4, 1960 | 1,415.85 | ----- | 12 | 2.0 | 0.00 | 59 | 212 | 1,110 | 123 |
| 5----- | do----- | ----- | 50 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| Creel Bay | | | | | | | | | | |
| 22----- | Ju'y 16, 1954 | 1,412.80 | 78 | 11 | 1.04 | ----- | 120 | 398 | 2,250 | 236 |
| | Oct. 7, 1954 | 1,413.95 | ----- | ----- | ----- | ----- | 95 | 383 | 2,120 | ----- |
| | Apr. 14, 1955 ² | 1,414.91 | ----- | ----- | ----- | ----- | 14 | 34 | 185 | ----- |
| | June 26, 1955 | 1,416.68 | 64 | ----- | ----- | ----- | 80 | 321 | 1,730 | ----- |
| | Sept. 23, 1955 | 1,416.1 | ----- | ----- | 1.08 | ----- | 100 | 316 | 1,760 | 188 |
| | Jan. 4, 1956 ³ | ----- | ----- | 15 | 1.20 | ----- | 114 | 359 | 1,960 | 208 |
| | do ⁴ ----- | 1,416.17 | ----- | 13 | 1.18 | ----- | 108 | 355 | 1,950 | 195 |
| | do ⁵ ----- | ----- | ----- | 3.1 | 1.10 | ----- | 17 | 94 | 388 | 46 |
| | June 8, 1956 | 1,418.69 | 72 | 1.2 | 1.03 | ----- | 80 | 277 | 1,440 | 150 |
| | Sept. 23, 1956 | 1,419.04 | 53 | ----- | 1.01 | ----- | 95 | 246 | 1,300 | 144 |
| | Dec. 28, 1956 ³ | ----- | ----- | ----- | ----- | ----- | 90 | 279 | 1,440 | ----- |
| | do ⁴ ----- | 1,418.53 | ----- | 6.1 | 1.01 | ----- | 18 | 82 | 348 | 31 |
| | Apr. 28, 1957 | 1,418.65 | 50 | 5.8 | 1.00 | ----- | 70 | 181 | 1,000 | 112 |
| | Oct. 4, 1957 | 1,418.15 | 55 | 6.1 | 1.02 | ----- | 68 | 265 | 1,400 | 167 |
| | Jan. 13, 1958 ³ | ----- | ----- | 4.3 | 1.03 | ----- | 85 | 284 | 1,500 | 166 |
| | do ⁴ ----- | ----- | ----- | ----- | ----- | ----- | 80 | 287 | 1,570 | ----- |
| | do ⁵ ----- | ----- | ----- | 1.5 | 1.01 | ----- | 34 | 127 | 630 | 65 |
| | June 22, 1958 | 1,417.46 | 68 | ----- | 0.04 | ----- | 73 | 279 | 1,580 | ----- |
| | Oct. 3, 1958 | 1,416.78 | 47 | 3.0 | 0.02 | ----- | 66 | 296 | 1,530 | 169 |
| | Jan. 12, 1959 ³ | ----- | ----- | ----- | ----- | ----- | 68 | 338 | 1,730 | ----- |
| | do ⁵ ----- | 1,416.68 | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 21----- | Oct. 1, 1959 | 1,415.44 | 49 | 19 | 1.10 | ----- | 71 | 336 | 1,750 | 194 |
| 22----- | Jan. 21, 1960 ³ | ----- | ----- | 19 | 1.04 | ----- | 74 | 352 | 1,840 | 199 |
| 26----- | do ⁴ ----- | ----- | ----- | 4.0 | 1.04 | ----- | 19 | 100 | 461 | 43 |
| 26----- | May 4, 1960 | 1,415.85 | 41 | 19 | 1.04 | 0.00 | 77 | 347 | 1,790 | 187 |
| 22----- | Sept. 29, 1960 | 1,414.96 | 53 | 12 | 0.08 | 0.00 | 84 | 367 | 1,890 | 211 |
| Main Part of Devils Lake | | | | | | | | | | |
| 35----- | July 16, 1954 | 1,412.80 | 75 | 11 | 1.01 | ----- | 93 | 415 | 2,200 | 222 |
| | Oct. 7, 1954 | 1,413.95 | ----- | ----- | ----- | ----- | 100 | 384 | 2,140 | ----- |
| | Apr. 14, 1955 ² | ----- | ----- | ----- | ----- | ----- | 23 | 77 | 409 | ----- |
| | June 26, 1955 | 1,416.68 | 62 | ----- | ----- | ----- | 81 | 316 | 1,730 | ----- |
| 18----- | June 26, 1955 | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 12----- | do----- | ----- | 67 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 8----- | Sept. 24, 1955 | ----- | 52 | ----- | 1.04 | ----- | 98 | 320 | ----- | ----- |
| 35----- | Jan. 4, 1956 ³ | ----- | ----- | 16 | 1.12 | ----- | 105 | 350 | 1,920 | 202 |
| | do ⁴ ----- | ----- | ----- | 13 | 1.17 | ----- | 106 | 354 | 1,940 | 200 |
| | do ⁵ ----- | ----- | ----- | 4.0 | 1.08 | ----- | 26 | 95 | 915 | 51 |
| | June 8, 1956 | 1,418.69 | 71 | 2.7 | 1.02 | ----- | 75 | 283 | 1,430 | 153 |
| | Sept. 23, 1956 | 1,419.04 | 51 | ----- | ----- | ----- | ----- | ----- | 1,320 | ----- |
| | Dec. 28, 1956 ³ | ----- | ----- | 11 | 1.00 | ----- | 90 | 279 | 1,440 | 150 |
| | do ⁴ ----- | 1,418.53 | ----- | ----- | ----- | ----- | 90 | 274 | 1,520 | ----- |
| | do ⁵ ----- | ----- | ----- | 2.8 | 1.01 | ----- | 33 | 86 | 376 | 34 |
| | Apr. 28, 1957 | 1,418.65 | 51 | 5.1 | 1.07 | ----- | 95 | 273 | 1,430 | 153 |
| | Oct. 4, 1957 | 1,418.15 | ----- | 4.0 | 1.01 | ----- | 78 | 264 | 1,410 | 162 |
| | Jan. 13, 1958 ³ | ----- | ----- | 4.3 | 1.02 | ----- | 80 | 287 | 1,610 | 166 |
| | do ⁴ ----- | ----- | ----- | ----- | ----- | ----- | 80 | 287 | 1,570 | ----- |
| | June 22, 1958 | 1,417.46 | 71 | 2.6 | 0.07 | ----- | 65 | 282 | 1,500 | 164 |
| | Oct. 3, 1958 | 1,416.78 | 47 | ----- | 0.05 | ----- | 64 | 297 | ----- | ----- |
| | Jan. 13, 1959 ³ | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| | do ⁵ ----- | 1,416.68 | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |

See footnotes at end of table.

of water in Devils Lake and bays

lion except as indicated]

| Bicar- bonate (HCO ₃) | Car- bonate (CO ₃) | Sul- fate (SO ₄) | Chlo- ride (Cl) | Fluo- ride (F) | Ni- trate (NO ₃) | Boron (B) | Dissolved solids | | Hard- ness as CaCO ₃ | Specific conduct- ance (mil- licromhos per cm at 25°C) | pH |
|---|--------------------------------------|------------------------------------|-----------------------|----------------------|------------------------------------|--------------|------------------|---------------------|---------------------------------------|---|-----|
| | | | | | | | Calcu- lated | Residue at 180°C | | | |
| Sixmile Bay—Continued | | | | | | | | | | | |
| 548 | 0 | 935 | 205 | — | — | — | — | — | 666 | 2,960 | 8.1 |
| 778 | 20 | 4,230 | 936 | 0.2 | 0.5 | 1.4 | 8,270 | 8,340 | 1,740 | 10,100 | 8.3 |
| 485 | 0 | 2,410 | 522 | .1 | .5 | 1.1 | 4,690 | 4,720 | 1,020 | 6,150 | 7.4 |
| — | — | — | — | — | — | — | — | — | — | 7,020 | — |
| Creel Bay—Continued | | | | | | | | | | | |
| 666 | 81 | 4,780 | 1,060 | 1.0 | 0.5 | 1.7 | 9,270 | 9,340 | 1,940 | 11,200 | 8.7 |
| 683 | 60 | 4,350 | 966 | — | — | — | — | 8,690 | 1,810 | 10,400 | 8.6 |
| 94 | 0 | 398 | 85 | — | — | — | — | 787 | 174 | 1,240 | 7.7 |
| 554 | 79 | 3,730 | 795 | — | — | — | — | 7,170 | 1,520 | 8,920 | 8.8 |
| 648 | 53 | 3,750 | 815 | — | — | — | — | 7,410 | 1,550 | 9,180 | 8.6 |
| 742 | 55 | 4,250 | 920 | .6 | 9.2 | 1.5 | 8,260 | 8,340 | 1,760 | 10,100 | 8.5 |
| 750 | 43 | 4,100 | 910 | .6 | 10 | 1.4 | 8,060 | 8,240 | 1,730 | 9,970 | 8.4 |
| 175 | 0 | 865 | 204 | .4 | 1.9 | .41 | 1,710 | 1,750 | 427 | 2,540 | 7.7 |
| 514 | 75 | 3,100 | 690 | .6 | .5 | 1.2 | 6,070 | 6,280 | 1,340 | 7,970 | 8.8 |
| 504 | 71 | 2,800 | 627 | .6 | 2.0 | 1.1 | 5,540 | 5,780 | 1,250 | 7,380 | 8.7 |
| 552 | 73 | 3,100 | — | — | — | — | — | — | 1,370 | 7,760 | 8.8 |
| 156 | 0 | 860 | 139 | .2 | .1 | .34 | 1,560 | 1,590 | 384 | 2,280 | 7.7 |
| 440 | 14 | 2,100 | 444 | .3 | 2.5 | .93 | 4,150 | 4,140 | 920 | 5,630 | 8.4 |
| 624 | 0 | 2,940 | 649 | .5 | 6.8 | 1.0 | 5,470 | 5,960 | 1,260 | 7,520 | 8.0 |
| 580 | 43 | 3,220 | 740 | .2 | 2.2 | 1.1 | 6,380 | 6,430 | 1,380 | 8,050 | 8.7 |
| 588 | 43 | 3,220 | — | .1 | — | — | — | — | 1,380 | 7,920 | 8.6 |
| 284 | 0 | — | 280 | — | .6 | .49 | 2,700 | 2,730 | 608 | 3,760 | 7.8 |
| 508 | 77 | 3,140 | 693 | .2 | — | — | — | — | 1,330 | 7,850 | 8.8 |
| 637 | 0 | 3,380 | 741 | .2 | 7.4 | 1.3 | 6,510 | 6,650 | 1,380 | 8,410 | 8.2 |
| 717 | 0 | 3,810 | 849 | — | — | — | — | 7,530 | 1,560 | 9,340 | 7.7 |
| 170 | 0 | 1,010 | 169 | — | — | — | — | — | 428 | 2,680 | 7.2 |
| 719 | 0 | 3,840 | 835 | .2 | .5 | 1.3 | 7,400 | 7,620 | 1,560 | 9,300 | 8.1 |
| 751 | 0 | 3,960 | 866 | .2 | 8.2 | 1.4 | 7,690 | 7,820 | 1,630 | 9,640 | 8.0 |
| 193 | 0 | 1,080 | 195 | .1 | .9 | .37 | 2,000 | 2,050 | 458 | 2,900 | 7.8 |
| 757 | 0 | 3,940 | 878 | .2 | 1.8 | 1.6 | 7,610 | 7,930 | 1,620 | 9,580 | 7.6 |
| 799 | 0 | 4,160 | 900 | .2 | 5.3 | 1.6 | 8,030 | 8,240 | 1,720 | 9,970 | 7.9 |
| Main Part of Devils Lake—Continued | | | | | | | | | | | |
| 738 | 43 | 4,800 | 1,050 | 0.6 | 5.3 | 1.6 | 9,200 | 9,410 | 1,940 | 11,300 | 8.5 |
| 676 | 67 | 4,480 | 974 | — | — | — | — | 8,530 | 1,830 | 10,500 | 8.6 |
| 157 | 10 | 885 | 186 | — | — | — | — | 1,750 | 376 | 2,560 | 8.5 |
| 558 | 75 | 3,650 | 788 | — | — | — | — | 7,080 | 1,500 | 8,780 | 8.8 |
| — | — | — | — | — | — | — | — | — | — | 8,880 | — |
| 678 | 39 | — | — | — | — | — | — | 7,460 | 1,560 | 8,880 | — |
| — | — | — | — | — | — | — | — | — | — | 9,160 | 8.5 |
| 712 | 55 | 3,980 | 900 | .6 | 5.7 | 1.4 | 7,890 | 8,070 | 1,700 | 9,830 | 8.4 |
| 740 | 43 | 4,050 | 900 | .6 | 8.9 | 1.4 | 7,980 | 8,140 | 1,720 | 9,910 | 8.4 |
| 216 | 0 | 1,950 | 240 | .4 | 2.6 | .45 | 3,390 | 3,440 | 456 | 4,650 | 7.6 |
| 512 | 77 | 3,100 | 690 | .6 | .6 | 1.2 | 6,070 | 6,360 | 1,350 | 8,030 | 8.8 |
| 536 | 59 | 2,800 | — | — | — | — | — | 5,820 | 1,270 | 7,390 | 8.7 |
| 564 | 71 | 3,030 | 687 | .6 | .5 | 1.5 | 6,040 | 6,240 | 1,370 | 7,820 | 8.8 |
| 560 | 63 | 3,080 | — | — | — | — | — | — | 1,350 | 7,720 | 8.8 |
| 198 | 0 | 930 | 149 | .2 | .1 | .42 | 1,710 | 1,760 | 436 | 2,500 | 8.1 |
| 688 | 0 | 2,890 | 647 | .5 | .6 | 1.1 | 5,840 | 6,210 | 1,360 | 7,800 | 8.2 |
| 648 | 0 | 2,800 | 659 | .5 | 3.4 | 1.0 | 5,700 | 5,970 | 1,280 | 7,570 | 8.1 |
| 656 | 28 | 3,220 | 750 | .1 | 2.9 | 1.1 | 6,470 | 6,440 | 1,380 | 8,060 | 8.5 |
| 596 | 39 | 3,200 | — | .1 | — | — | — | — | 1,380 | 8,060 | 8.5 |
| 497 | 75 | 3,070 | 701 | .3 | .4 | 1.0 | 6,020 | 6,270 | 1,320 | 7,870 | 8.8 |
| 644 | 0 | — | — | — | — | — | — | 6,660 | 1,380 | 8,380 | 8.2 |
| 724 | 0 | 3,850 | 844 | — | — | — | — | 7,530 | 1,580 | 9,390 | 7.7 |
| — | — | — | — | — | — | — | — | — | — | 3,140 | — |

TABLE 4.—*Chemical analyses of water*

| Sampling site (see pl. 1) | Date of collection | Lake altitude (feet) | Tem- per- ature (° F.) | Silica (SiO ₂) | Iron (Fe) | Man- ganese (Mn) | Cal- cium (Ca) | Mag- nesium (Mg) | Sodium (Na) | Potas- sium (K) |
|---|-----------------------|----------------------------|---------------------------------|-------------------------------|--------------|------------------------|----------------------|------------------------|----------------|-----------------------|
| Main part of Devils Lake—Continued | | | | | | | | | | |
| 13..... | Oct. 4, 1959 | 1,415.44 | ----- | 19 | 0.07 | ----- | 72 | 338 | 1,750 | 199 |
| 28..... |do..... | | 54 | 20 | .07 | ----- | 72 | 341 | 1,750 | 206 |
| 29..... |do..... | | 52 | 19 | .08 | ----- | 58 | 344 | 1,700 | 214 |
| 20..... |do..... | | 52 | 18 | .06 | ----- | 72 | 341 | 1,780 | 219 |
| 34..... | Oct. 5, 1959 | | 49 | 19 | .16 | ----- | 73 | 333 | 1,770 | 219 |
| 6..... |do..... | | 49 | 19 | .12 | ----- | 74 | 342 | 1,750 | 207 |
| 7..... | May 4, 1960 | 1,415.85 | ----- | 17 | .02 | 0.00 | 71 | 334 | 1,720 | 179 |
| 35..... |do..... | | 53 | 16 | .02 | .00 | 71 | 339 | 1,740 | 187 |
| 17..... |do..... | | 40 | 19 | .04 | .01 | 70 | 335 | 1,730 | 185 |
| 35..... | Sept. 29, 1960 | 1,414.96 | 52 | 12 | .05 | .06 | 83 | 363 | 1,840 | 220 |
| Mission Bay | | | | | | | | | | |
| 41..... | Oct. 2, 1959 | 1,414.25 | 44 | 18 | 0.15 | ----- | 73 | 520 | 2,720 | 289 |
| 43..... | May 4, 1960 | 1,414.91 | 46 | 7.0 | .02 | 0.00 | 55 | 448 | 2,240 | 244 |
| 37..... | Sept. 29, 1960 | 1,414.16 | 50 | 18 | .08 | .00 | 73 | 573 | 2,960 | 326 |
| East Bay | | | | | | | | | | |
| 44..... | June 16, 1960 | ----- | 82 | 5.9 | 0.10 | 0.00 | 130 | 330 | 2,030 | 314 |
| 46..... |do..... | ----- | 64 | 2.6 | .03 | .00 | 54 | 354 | 2,040 | 241 |
| 48..... |do..... | ----- | 72 | 15 | .04 | .00 | 194 | 264 | 1,490 | 253 |
| Black Tiger Bay | | | | | | | | | | |
| 47..... | Oct. 3, 1959 | ----- | 52 | 3.1 | 0.08 | ----- | 87 | 1,820 | 10,300 | 866 |
| | May 5, 1960 | ----- | 51 | 5.3 | .04 | 0.00 | 58 | 522 | 3,200 | 273 |

¹ In solution when analyzed.² Affected by ice melt; not representative of most of the water.³ Just beneath ice.⁴ At bottom.⁵ Ice.

carried away by the wind. Clouds of windblown salt have been observed over the bay. The wind does not remove all the salts, however, for water in East Bay had higher dissolved solids than water in Six-mile Bay, the main part of Devils Lake, or Creel Bay.

Black Tiger Bay is a small bay that is connected to the southern end of East Bay by a culvert through the roadbed of a county road. However, any flow of water between East Bay and Black Tiger Bay in the 9 years of record is unlikely. In the two samples collected from Black Tiger Bay during 1959–60, the dissolved-solids content was higher after evaporation during the summer had decreased the volume of water in the bay and lower after the spring runoff had increased it.

Compared with the water in Big Coulee, the water in Devils Lake and its bays had a lower average percentage of equivalents per million of calcium, magnesium, and bicarbonate plus carbonate and a higher average percentage of equivalents per million of sodium, sulfate, and

in Devils Lake and bays—Continued

| Bicar- bonate (HCO ₃) | Car- bonate (CO ₃) | Sul- fate (SO ₄) | Chlo- ride (Cl) | Fluo- ride (F) | Ni- trate (NO ₃) | Boron (B) | Dissolved solids | | Hard- ness as CaCO ₃ | Specific conduct- ance (mic- romhos per cm at 25°C) | pH |
|---|--------------------------------------|------------------------------------|-----------------------|----------------------|------------------------------------|--------------|------------------|---------------------|---------------------------------------|--|-----|
| | | | | | | | Calcu- lated | Residue at 180°C | | | |
| Main part of Devils Lake—Continued | | | | | | | | | | | |
| 724 | 0 | 3,800 | 841 | 0.1 | 0.9 | 1.3 | 7,380 | 7,610 | 1,570 | 9,450 | 8.2 |
| 715 | 0 | 3,800 | 850 | .1 | .8 | 1.3 | 7,390 | 7,570 | 1,580 | 9,370 | 8.2 |
| 720 | 0 | 3,830 | 847 | .1 | 2.4 | 1.4 | 7,440 | 7,570 | 1,560 | 9,340 | 8.2 |
| 727 | 0 | 3,850 | 844 | .2 | .7 | 1.3 | 7,480 | 7,610 | 1,580 | 9,370 | 8.2 |
| 699 | 12 | 3,840 | 849 | .1 | 1.0 | 1.4 | 7,460 | 7,620 | 1,560 | 9,860 | 8.3 |
| 721 | 0 | 3,860 | 849 | .2 | 1.0 | 1.3 | 7,460 | 7,650 | 1,590 | 9,380 | 8.2 |
| 721 | 0 | 3,770 | 808 | .1 | 1.6 | 1.6 | 7,260 | 7,530 | 1,550 | 9,250 | 7.9 |
| 726 | 0 | 3,820 | 818 | .2 | 1.3 | 1.7 | 7,350 | 7,590 | 1,570 | 9,380 | 7.9 |
| 721 | 0 | 3,760 | 812 | .2 | 1.4 | 1.6 | 7,270 | 7,550 | 1,550 | 9,270 | 7.9 |
| 797 | 0 | 4,120 | 908 | .2 | 2.6 | 1.9 | 7,940 | 8,230 | 1,700 | 9,910 | 7.7 |
| Mission Bay—Continued | | | | | | | | | | | |
| 814 | 69 | 5,820 | 1,320 | 0.0 | 0.7 | 2.2 | 11,200 | 11,500 | 2,320 | 13,400 | 8.5 |
| 725 | 27 | 5,050 | 1,090 | .2 | .3 | 2.6 | 9,520 | 10,000 | 1,980 | 12,100 | 8.4 |
| 938 | 0 | 6,570 | 1,470 | .1 | 8.0 | 2.4 | 12,500 | 12,900 | 2,540 | 14,800 | 8.0 |
| East Bay—Continued | | | | | | | | | | | |
| 219 | 43 | 4,450 | 1,300 | 0.1 | 2.2 | 4.4 | 8,720 | 9,190 | 1,680 | 11,200 | 8.7 |
| 193 | 78 | 4,270 | 1,290 | .1 | .5 | 3.3 | 8,430 | 8,830 | 1,590 | 10,900 | 9.1 |
| 269 | 0 | 3,090 | 1,280 | .9 | .7 | 3.4 | 6,720 | 6,980 | 1,570 | 8,860 | 8.1 |
| Black Tiger Bay—Continued | | | | | | | | | | | |
| 523 | 103 | 21,500 | 5,170 | 0.2 | 4.9 | 6.3 | 40,100 | 41,400 | 7,680 | 39,200 | 8.6 |
| 529 | 0 | 6,570 | 1,800 | .0 | .9 | 3.8 | 12,700 | 13,400 | 2,290 | 15,500 | 7.7 |

chloride (fig. 6). The free movement of water between Sixmile Bay, Creel Bay, and the main part of Devils Lake has caused the average percentages of equivalents per million of the water to be nearly identical, and they are plotted as one point in figure 6. Although dissolved solids in the water in Devils Lake ranged from 4,140 to 9,410 ppm, the percentages of equivalents per million did not vary significantly.

EAST DEVILS LAKE

In the past, East Devils Lake received water from Devils Lake and its bays. In recent years, however, East Devils Lake has probably received no water from East Bay, and the water in the lake is probably local runoff from snowmelt and summer rains. Accumulation of salt in the past and continued evaporation of water has caused the concentration of dissolved solids in East Devils Lake to be higher than in the upstream lake and bays. The observed concentrations of dissolved solids in East Devils Lake from 1956 to 1960 averaged 60,700 ppm (table 5). Each year that samples were collected, the concentrations in the fall were higher than in the previous spring because of evaporation.

TABLE 5.—*Chemical analyses*

[Results in parts per million]

| Sampling site (see pl. 1) | Date of collection | Lake altitude (feet) | Tem- per- ature (°F) | Silica (SiO ₂) | Iron (Fe) | Man- ganese (Mn) | Cal- cium (Ca) | Mag- nesium (Mg) | Sod- ium (Na) | Potas- sium (K) |
|------------------------------|-----------------------|----------------------------|-------------------------------|-------------------------------|-------------------|------------------------|----------------------|------------------------|---------------------|-----------------------|
| 50..... | June 8, 1956 | 1,402.0 | | | ¹ 0.05 | | 48 | 2,330 | 11,300 | 978 |
| | Sept. 24, 1956 | 1,400.7 | 64 | | ¹ 1.01 | | 36 | 2,740 | 13,400 | 1,230 |
| | Apr. 29, 1957 | 1,401.2 | 67 | 11 | 1.04 | | 144 | 2,270 | 10,900 | 1,020 |
| | Oct. 4, 1957 | 1,401.5 | 60 | 13 | 1.62 | | 24 | 2,440 | 12,100 | 1,050 |
| | June 23, 1958 | 1,401.3 | | 6.5 | .03 | | 128 | 2,430 | 12,600 | 1,080 |
| | Oct. 3, 1958 | 1,401.67 | 55 | 4.7 | .08 | | 57 | 2,930 | 14,400 | 1,290 |
| 55..... | Oct. 3, 1959 | 1,399.94 | 64 | 7.2 | 1.08 | | 27 | 3,530 | 17,800 | 1,610 |
| | do..... | | 48 | 7.1 | .79 | | 44 | 3,450 | 16,700 | 1,370 |
| 58..... | May 7, 1960 | 1,400.81 | 55 | | | | | | | |
| 50..... | do..... | | 52 | 4.2 | .05 | 0.03 | 52 | 2,810 | 12,100 | 1,080 |
| 58..... | Sept. 30, 1960 | | 47 | 2.4 | .08 | .00 | 121 | 3,650 | 17,500 | 1,570 |

¹ In solution when analyzed.

The maximum amount of a salt that can be in solution depends on the solubility of the salt; sodium sulfate is more soluble than calcium carbonate. In the past, calcium bicarbonate precipitated from solution as water moved downstream toward East Devils Lake; therefore, the percentage of sodium sulfate in the water that entered the lake was relatively high. Now, however, inflow consists wholly of local runoff, and it contains more calcium bicarbonate than sodium sulfate. Because of continued evaporation, intermittent inflow, and difference in solubility of these salts, more sodium sulfate than calcium bicarbonate still is accumulating.

The water in East Devils Lake had a lower average percentage of equivalents per million of calcium and a higher average percentage of equivalents per million of sulfate than any other body of water in the Devils Lake chain; it had a higher average percentage of equivalents per million of magnesium than the water in Devils Lake and its bays. While lake levels are low, no change is expected. If lake levels rise, the concentration of dissolved solids and the percentage of sodium sulfate will decrease.

EASTERN AND WESTERN STUMP LAKES

Eastern and western Stump Lakes formerly received water that had passed through all the lakes in the system and water directly from several coulees. Since the cessation of flow from East Devils Lake, the Stump Lakes have been maintained only by local runoff. Of the drainage area of Stump Lakes of about 400 square miles, 350 square miles drains into western Stump Lake. Western and eastern Stump Lakes are connected by three 24-inch culverts that pass under a road between the lakes. Water begins to flow through the culverts when the surface of

of water in East Devils Lake

except as indicated]

| Bicar- bonate (HCO ₃) | Car- bonate (CO ₃) | Sulfate (SO ₄) | Chlo- ride (Cl) | Fluo- ride (F) | Ni- trate (NO ₃) | Boron (B) | Dissolved solids | | Hard- ness as CaCO ₃ | Specific conduct- ance (mi- cromhos per cm at 25°C) | pH |
|---|--------------------------------------|-------------------------------|-----------------------|----------------------|------------------------------------|--------------|------------------|---------------------|---------------------------------------|--|-------|
| | | | | | | | Calcu- lated | Residue at 180°C | | | |
| 1,100 | 468 | 27,100 | 4,520 | ----- | 2.4 | 6.1 | 47,300 | 49,000 | 9,710 | 43,800 | 8.9 |
| 1,820 | 368 | 31,800 | 5,330 | ----- | .0 | 7.0 | 55,800 | 58,900 | 11,400 | 49,800 | 8.7 |
| 1,340 | 360 | 24,800 | 4,410 | ----- | 4.3 | 5.6 | 44,500 | 45,600 | 9,680 | 41,500 | 8.8 |
| 1,660 | 166 | 28,900 | 4,660 | ----- | ----- | 6.2 | 50,200 | 51,700 | 10,100 | 45,100 | 8.5 |
| 1,270 | 408 | 29,400 | 4,720 | 0.3 | 4.0 | 6.3 | 51,400 | 52,200 | 10,300 | 45,600 | 8.8 |
| 1,600 | 355 | 35,300 | 5,760 | .5 | 57 | 8.3 | 60,900 | 63,100 | 12,200 | 52,800 | 8.5 |
| 1,950 | 422 | 42,500 | 6,670 | .1 | 5.3 | 9.1 | 73,500 | 75,000 | 14,600 | 59,700 | 8.6 |
| 2,050 | 401 | 40,900 | 6,520 | .0 | 4.5 | 8.8 | 70,400 | 74,100 | 14,300 | 56,300 | 8.6 |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 47,400 | ----- |
| 1,590 | 325 | 30,200 | 5,100 | .2 | 2.5 | 7.1 | 52,500 | 56,800 | 11,700 | 47,900 | 8.6 |
| 1,970 | 290 | 44,200 | 6,940 | .1 | .4 | 12 | 75,300 | 80,300 | 15,300 | 62,700 | 8.5 |

western Stump Lake reaches an altitude of 1,399.8 feet. Eastern Stump Lake has contained a few feet of water in recent years. Western Stump Lake, with the exception of its southeast bay, has been dry once and probably has been dry two other times during the past 5 years.

During 1956-60 the observed dissolved solids averaged 23,100 ppm for western Stump Lake and 127,000 ppm for eastern Stump Lake (table 6). The highest concentrations were observed in the fall; the lowest in the spring. Western Stump Lake occasionally overflows into eastern Stump Lake, and some salt that is temporarily stored in western Stump Lake is then flushed into eastern Stump Lake. Eastern Stump Lake, however, has no outlet and has had none since its surface dropped below the 1,453-foot altitude many years ago; consequently, salts that entered eastern Stump Lake accumulated there. The concentrations of dissolved solids in water from eastern Stump Lake exceeded considerably the 34,000 ppm commonly attributed to sea water.

The water in eastern Stump Lake is saturated or almost saturated with sodium sulfate. Evaporation during the summer decreases the volume of water in the lake. In the fall and winter when the volume of the lake and the temperature of the water are relatively low, a layer of loose crystals of hydrated sodium sulfate (mirabilite) about one-sixteenth to one-eighth inch in diameter is deposited on the bed of the lake (figs. 7 and 8). In the summer when the volume of the lake and the temperature of the water are relatively high, the salt deposited during fall and winter nearly disappears; the large interlocking crystals of mirabilite which are left form a lower discontinuous porous layer of the bed. In general, the volume of water in the lake is higher and the parts per million of dissolved solids are lower in the spring than in the fall; yet the total weight of dissolved solids probably is more in the spring because of solution of salts from the lakebed. Measurements of

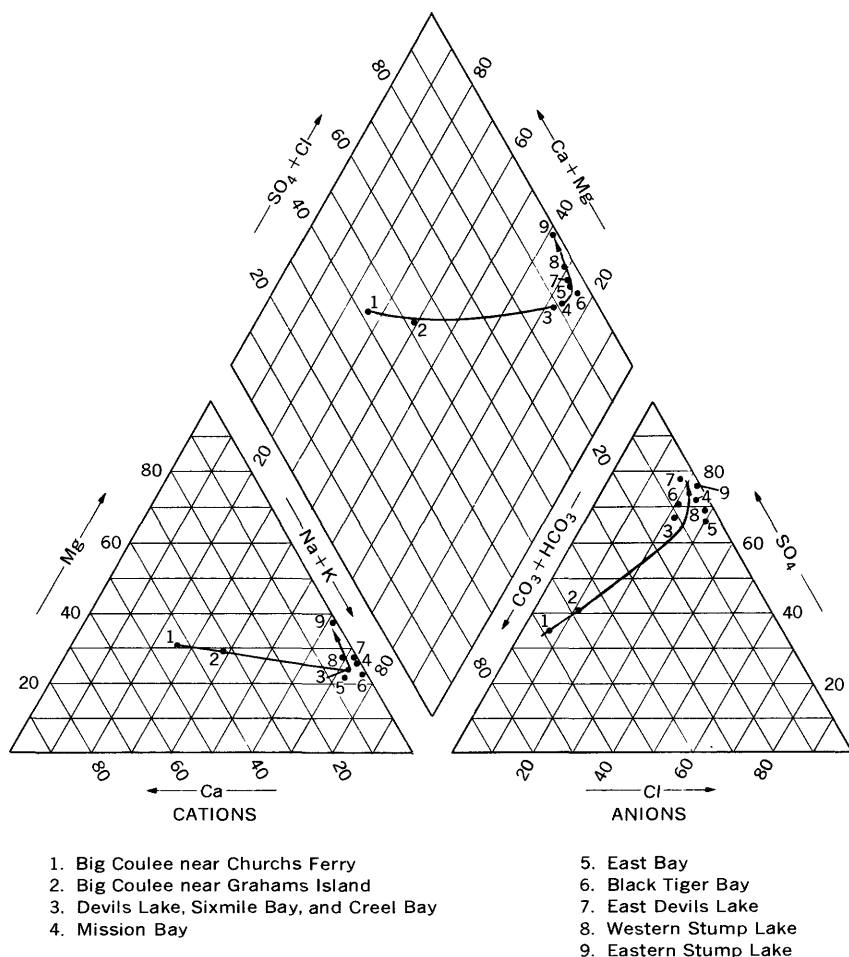


FIGURE 6.—Average percentage of equivalents per million of the major constituents in the water of the Devils Lake chain.

specific conductance on May 7, 1960, at sampling sites where the water was 4–6 feet deep indicate very little variation in concentration from place to place or with depth.

Because Stump Lake has received no water from East Devils Lake in many years and because bicarbonate is the principal anion in the runoff entering western Stump Lake, the percentage of equivalents per million of sulfate is less in western Stump Lake than in East Devils Lake. Some sulfate may be converted to sulfide through sulfate reduction in western Stump Lake, especially in the bed of the lake. The water in western Stump Lake and the water in eastern Stump Lake differ only slightly in percentages of equivalents per million except for sodium and sulfate. (See fig. 6.)



FIGURE 7.—Salt bars in eastern Stump Lake and salt deposits along the edge of the water. Snow is in the foreground.

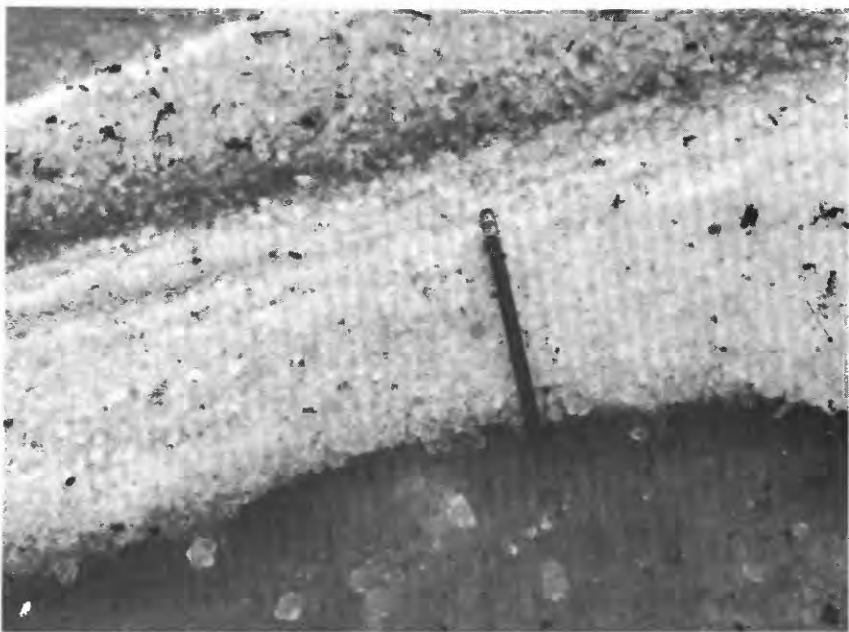


FIGURE 8.—Closeup of salt crystals at the edge of the water in eastern Stump Lake.

TABLE 6.—*Chemical analyses*

[Results in parts per

| Sampling site (see pl. 1) | Date of collection | Lake altitude (feet) | Tem- per- ature (°F) | Silica (SiO ₂) | Iron (Fe) | Man- ganese (Mn) | Cal- cium (Ca) | Mag- nesium (Mg) | Sod- ium (Na) | Potas- sium (K) |
|------------------------------|-----------------------|----------------------------|-------------------------------|-------------------------------|-------------------|------------------------|----------------------|------------------------|---------------------|-----------------------|
| Western Stump Lake | | | | | | | | | | |
| 68..... | June 25, 1955 | 11,394 | 62 | ----- | ----- | ----- | ----- | ----- | 4,520 | ----- |
| | Sept. 24, 1955 | ----- | 47 | 38 | ----- | ----- | 182 | 2,780 | 12,000 | 880 |
| | June 8, 1956 | 1,395.7 | 81 | ----- | ² 0.05 | ----- | 114 | 407 | 2,100 | 143 |
| | Sept. 24, 1956 | 1,395.2 | 58 | ----- | ² 0.00 | ----- | 149 | 909 | 4,260 | 279 |
| | Apr. 29, 1957 | 1,395.3 | 66 | 2.8 | ² 0.00 | ----- | 99 | 777 | 3,740 | 245 |
| 67..... | Oct. 4, 1957 | 1,394.6 | 60 | 29 | ² 0.12 | ----- | 154 | 510 | 2,370 | 176 |
| | June 23, 1958 | 1,394.4 | 70 | 23 | .03 | ----- | 116 | 856 | 4,070 | 143 |
| | Oct. 3, 1958 | 1,395.0 | 60 | 29 | .83 | ----- | 304 | 2,930 | 12,000 | 755 |
| 67..... | Oct. 10, 1959 | 1,394.60 | 35 | 4.4 | .41 | ----- | 152 | 842 | 3,520 | 249 |
| 68..... | May 6, 1960 | 1,395.59 | 45 | 3.6 | .02 | 0.00 | 107 | 232 | 1,180 | 116 |
| 62..... | | | 52 | 19 | .14 | .00 | 112 | 219 | 1,110 | 110 |
| 63..... | | | 52 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 61..... | | | 52 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 64..... | | | 55 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 68..... | June 17, 1960 | 1,395.71 | 76 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 60..... | | | 81 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 66..... | | | 82 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 59..... | | | 80 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 68..... | Sept. 30, 1960 | 1,394.58 | 56 | 19 | .08 | .00 | 538 | 2,570 | 10,500 | 837 |
| Eastern Stump Lake | | | | | | | | | | |
| 78..... | June 25, 1955 | ----- | 64 | ----- | ----- | ----- | ----- | ----- | 27,300 | ----- |
| | Sept. 24, 1955 | ----- | 51 | ----- | ----- | ----- | 201 | 7,590 | 29,000 | 1,750 |
| | June 8, 1956 | 1,384.9 | 79 | ----- | ² 0.07 | ----- | 184 | 6,250 | 21,700 | 1,320 |
| | Sept. 24, 1956 | 1,384.3 | 60 | ----- | ² 0.00 | ----- | 225 | 6,920 | 27,600 | 1,490 |
| | Apr. 29, 1957 | 1,384.8 | 72 | 10 | ² 0.08 | ----- | 326 | 6,420 | 16,700 | 1,330 |
| 75..... | Oct. 4, 1957 | 1,384.50 | 60 | 16 | ² 2.1 | ----- | 198 | 6,690 | 30,600 | 1,500 |
| | June 23, 1958 | 1,384.32 | 71 | 5.8 | .11 | ----- | 308 | 7,080 | 30,100 | 1,460 |
| | Oct. 3, 1958 | 1,383.84 | 51 | 11 | .09 | ----- | 393 | 9,080 | 26,200 | 1,930 |
| | Oct. 9, 1959 | 1,383.21 | 38 | 9.1 | .28 | ----- | 381 | 11,000 | 19,500 | 2,360 |
| 78..... | May 7, 1960 | 1,383.77 | 54 | 6.8 | .10 | 0.00 | 319 | 7,690 | 21,200 | 1,950 |
| 73..... | do. ³ | | 54 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 73..... | do. ⁴ | | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 76..... | do. ³ | | 54 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 76..... | do. ⁴ | | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 80..... | do. ³ | | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 80..... | do. ⁴ | | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 80..... | June 15, 1960 | 1,383.69 | 70 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 71..... | | | 70 | ----- | ----- | ----- | ----- | ----- | ----- | ----- |
| 78..... | Sept. 30, 1960 | 1,382.76 | 54 | 10 | .09 | .11 | 323 | 11,400 | 29,900 | 2,280 |

¹ Estimated.² In solution when analyzed.³ At surface.⁴ At bottom.

TRACE ELEMENTS AND RADIOACTIVITY IN THE WATER

In the late 1880's the last of the game fish disappeared from Devils Lake. Originally, their disappearance was attributed to the high dissolved solids in the lake. However, in the early 1920's G. A. Abbott, while experimenting with the lethality of the water in Devils Lake to small fish (stickle-back minnows), found that the water contained

of water in Stump Lake

million except as indicated]

| Bicar- bonate (HCO ₃) | Car- bonate (CO ₃) | Sulfate (SO ₄) | Chlo- ride (Cl) | Fluo- ride (F) | Ni- trate (NO ₃) | Boron (B) | Dissolved solids | | Hard- ness as Ca CO ₃ | Specific conduct- ance (mi- cromhos per cm at 25° C) | pH |
|---|--------------------------------------|-------------------------------|-----------------------|----------------------|------------------------------------|--------------|------------------|---------------------|--|---|-------|
| | | | | | | | Calcu- lated | Residue at 180°C | | | |
| Western Stump Lake—Continued | | | | | | | | | | | |
| ----- | ----- | 10, 500 | 2, 450 | ----- | ----- | ----- | ----- | 19, 600 | 4, 360 | 21, 000 | ----- |
| 790 | 62 | 29, 700 | 6, 220 | ----- | 3.1 | 6.9 | 52, 600 | 53, 000 | 11, 900 | 46, 300 | 8.3 |
| 280 | 65 | 4, 470 | 1, 220 | ----- | .6 | 2.0 | 8, 680 | 8, 970 | 1, 960 | 11, 200 | 8.8 |
| 430 | 31 | 9, 650 | 2, 560 | ----- | .8 | 3.4 | 18, 100 | 18, 900 | 4, 110 | 20, 200 | 8.4 |
| 214 | 14 | 8, 480 | 2, 250 | ----- | 1.0 | 2.5 | 15, 700 | 16, 100 | 3, 440 | 18, 100 | 8.4 |
| 497 | 0 | 5, 270 | 1, 490 | ----- | 5.0 | 2.0 | 10, 300 | 10, 400 | 2, 480 | 12, 500 | 7.9 |
| 404 | 50 | 8, 910 | 2, 550 | 0.3 | 5.1 | 3.1 | 16, 900 | 17, 800 | 3, 810 | 19, 500 | 8.6 |
| 975 | 0 | 28, 900 | 7, 100 | .6 | 38 | 9.0 | 52, 500 | 54, 400 | 12, 800 | 48, 400 | 7.6 |
| 233 | 0 | 8, 360 | 2, 180 | .1 | 2.1 | 2.4 | 15, 400 | 16, 500 | 3, 840 | 17, 800 | 7.2 |
| 249 | 0 | 2, 470 | 850 | .1 | .5 | 1.3 | 5, 080 | 5, 240 | 1, 220 | 6, 790 | 7.7 |
| 275 | 0 | 2, 250 | 803 | .2 | .6 | 1.3 | 4, 760 | 4, 920 | 1, 180 | 6, 500 | 7.6 |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 7, 100 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 7, 170 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 6, 650 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 9, 880 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 10, 900 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 12, 600 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 11, 900 | ----- |
| 569 | 0 | 25, 600 | 7, 120 | .1 | .0 | 8.9 | 47, 500 | 51, 200 | 11, 900 | 45, 500 | 7.6 |
| Eastern Stump Lake—Continued | | | | | | | | | | | |
| ----- | ----- | 67, 300 | 11, 000 | ----- | ----- | ----- | ----- | 121, 000 | 25, 900 | 79, 300 | ----- |
| 1, 350 | 95 | 75, 100 | 13, 500 | ----- | ----- | ----- | ----- | 139, 000 | 31, 700 | 84, 600 | 8.2 |
| 921 | 193 | 55, 700 | 11, 300 | ----- | 1.8 | 12 | 97, 100 | 104, 000 | 26, 200 | 74, 400 | 8.4 |
| 1, 200 | 141 | 72, 000 | 12, 500 | ----- | 5.3 | 15 | 122, 000 | 135, 000 | 29, 000 | 82, 100 | 8.3 |
| 1, 060 | 132 | 45, 200 | 11, 600 | ----- | 2.5 | 14 | 82, 300 | 91, 100 | 27, 200 | 65, 300 | 8.4 |
| 1, 260 | 0 | 73, 000 | 11, 800 | ----- | ----- | 13 | 124, 000 | 129, 000 | 28, 000 | 83, 500 | 7.8 |
| 1, 090 | 186 | 75, 800 | 12, 600 | 0.3 | 5.4 | 13 | 128, 100 | 134, 300 | 29, 900 | 85, 000 | 8.4 |
| 1, 640 | 0 | 73, 200 | 16, 000 | 1.2 | 84 | 20 | 128, 000 | 136, 000 | 38, 300 | 85, 900 | 7.9 |
| 1, 990 | 0 | 59, 900 | 19, 000 | .2 | 14 | 22 | 112, 000 | 121, 000 | 46, 100 | 79, 800 | 8.2 |
| 1, 430 | 0 | 59, 200 | 13, 400 | .2 | 4.2 | 22 | 104, 000 | 117, 000 | 32, 400 | 77, 500 | 8.1 |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 100 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 200 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 600 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 300 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 400 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 77, 500 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 90, 300 | ----- |
| ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | ----- | 89, 300 | ----- |
| 1, 540 | 0 | 88, 400 | 19, 500 | .2 | .0 | 22 | 153, 000 | 170, 000 | 47, 700 | 94, 900 | 7.9 |

15 ppm of zinc. Further experimentation showed that a water solution of zinc sulfate containing 15 ppm of zinc was lethal to the same variety of fish that formerly populated the lake (Abbott, 1924, p. 183-194). McKee and Wolf (1963) reported that zinc concentrations as low as 0.3 ppm could be lethal to fish.

During 1948-52, the maximum measured concentration of zinc in Devils Lake was only 0.16 ppm (Swenson and Colby, 1955, p. 37). In September 1959, Creel Bay and eastern Stump Lake contained only 0.16 and 0.03 ppm of zinc, respectively (table 7). Possibly hydrogen

sulfide formed by biological activity in the lakebed caused the formation of zinc sulfide which precipitated and thus decreased the zinc in the lake water between 1924 and 1948 (Swenson and Colby, 1955, p. 35). If the generation of hydrogen sulfide were to cease, zinc might again accumulate in the lake. However, a rise in lake levels would compensate for the added zinc, and the zinc concentration probably would remain low.

The source of zinc in the water of Devils Lake has not been investigated. Zinc chloride treated ties were suggested as a possible source. These ties were burned along the railroad right-of-way as they were replaced by ties treated with better preservatives. However, if each tie contributed 10 pounds of zinc, ties from about 200 miles of track would have had to be burned to bring Devils Lake to a concentration of 15 ppm of zinc.

TABLE 7.—Observed radiochemical data and concentration of some trace elements

| Sampling site (see pl. 1) | Date of collection | Radiochemical data ($\mu\text{c}/\text{l}$) | | Some trace elements (parts per million) | | | | |
|------------------------------|-----------------------|--|------------------|--|------|------|-----------------------|------|
| | | Alpha activity | Beta activity | As | Cu | Pb | P (as PO_4) | Zn |
| 1..... | May 4, 1960 | ----- | ----- | --- | --- | --- | 0.56 | --- |
| 2..... | Oct. 5, 1959 | ----- | ----- | --- | --- | --- | .10 | --- |
| 3..... | May 4, 1960 | ----- | ----- | --- | --- | --- | .02 | --- |
| 6..... | Oct. 5, 1959 | ----- | ----- | --- | --- | --- | 1.1 | --- |
| 7..... | May 4, 1960 | ----- | ----- | --- | --- | --- | .14 | --- |
| 13..... | Oct. 4, 1959 | 100 \pm 70 | 340 \pm 40 | --- | --- | --- | 1.2 | --- |
| 15..... | Oct. 5, 1959 | ----- | ----- | 0.03 | 0.04 | 0.01 | ----- | --- |
| 17..... | May 4, 1960 | ----- | ----- | --- | --- | --- | .14 | --- |
| 20..... | Oct. 4, 1959 | <42 | 320 \pm 50 | --- | --- | --- | 1.2 | --- |
| 21..... | Sept. 30, 1959 | <44 | 280 \pm 40 | .04 | .08 | .01 | .90 | 0.16 |
| 22..... | Sept. 29, 1960 | ----- | ----- | --- | --- | --- | 2.3 | --- |
| 26..... | May 4, 1960 | ----- | ----- | --- | --- | --- | .06 | --- |
| 28..... | Oct. 4, 1959 | ----- | ----- | --- | --- | --- | 1.1 | --- |
| 29..... | do..... | ----- | ----- | --- | --- | --- | 1.2 | --- |
| 34..... | Oct. 5, 1959 | ----- | ----- | --- | --- | --- | 1.1 | --- |
| 35..... | {May 4, 1960 | ----- | ----- | --- | --- | --- | .14 | --- |
| 37..... | {Sept. 29, 1960 | ----- | ----- | --- | --- | --- | 1.8 | --- |
| 41..... | {Sept. 29, 1960 | ----- | ----- | --- | --- | --- | .85 | --- |
| 43..... | {Oct. 2, 1959 | <61 | 460 \pm 70 | --- | --- | --- | 1.1 | --- |
| 43..... | {May 4, 1960 | ----- | ----- | --- | --- | --- | .07 | --- |
| 44..... | June 16, 1960 | ----- | ----- | --- | --- | --- | .40 | --- |
| 46..... | do..... | ----- | ----- | --- | --- | --- | .00 | --- |
| 47..... | {Oct. 3, 1959 | ----- | ----- | --- | --- | --- | 1.0 | --- |
| 48..... | {May 5, 1960 | ----- | ----- | --- | --- | --- | .22 | --- |
| 48..... | {June 16, 1960 | ----- | ----- | --- | --- | --- | .20 | --- |
| 50..... | {Oct. 3, 1959 | ----- | ----- | --- | --- | --- | 1.3 | --- |
| 55..... | {May 7, 1960 | ----- | ----- | --- | --- | --- | .10 | --- |
| 55..... | {Oct. 3, 1959 | ----- | ----- | --- | --- | --- | 1.4 | --- |
| 58..... | {Sept. 30, 1960 | ----- | ----- | --- | --- | --- | .54 | --- |
| 62..... | {May 6, 1960 | ----- | ----- | --- | --- | --- | .10 | --- |
| 67..... | Oct. 10, 1959 | ----- | ----- | --- | --- | --- | .14 | --- |
| 68..... | {May 6, 1960 | ----- | ----- | --- | --- | --- | .03 | --- |
| 68..... | {Sept. 30, 1960 | ----- | ----- | --- | --- | --- | 2.2 | --- |
| 75..... | {Oct. 9, 1959 | ----- | ----- | --- | .19 | .40 | 3.3 | .03 |
| 78..... | {May 7, 1960 | ----- | ----- | --- | --- | --- | 1.2 | --- |
| 78..... | {Sept. 30, 1960 | ----- | ----- | --- | --- | --- | 5.3 | --- |

The most likely source of zinc is ground water. Even though ground-water movement into the lake probably is too slow to cause measurable changes of the major dissolved constituents, continued movement plus evaporation from the lake could cause a noticeable increase of zinc and other trace elements. Abbott and Voedisch (1938) reported on 25 wells near the major lakes of the basin in Ramsey, Benson, and Nelson Counties; they found that water in 20 of the wells contained zinc concentrations that ranged from 0.1 to 14 ppm.

In 1959, eastern Stump Lake had higher concentrations of copper and lead than Creel Bay or the main part of Devils Lake (table 7). According to McKee and Wolf (1963, p. 171), copper concentrations from 0.25 to 1.0 ppm are not toxic for most fish, but concentrations of 0.015–3.0 ppm have been toxic, particularly in soft water, to certain kinds of fish, crustaceans, mollusca, insects, phytoplankton, and zooplankton; lead concentrations as low as 0.1 ppm have been reported to be toxic or lethal to fish.

Small concentrations of iron, manganese, fluoride, arsenic, and boron were found in the lakes (tables 3–7). Probably none of these elements were present in concentrations high enough to be harmful to fish.

The maximum concentration of phosphorus (as PO_4) measured was in the water of eastern Stump Lake (table 7). In themselves, phosphates do not have toxic effects on fish and other aquatic life and may be beneficial to fish by increasing algae and zooplankton (McKee and Wolf, 1963).

The alpha and beta particle activities in Devils Lake were measured in 1959 (table 7); data are insufficient to determine if present activities are different from activities before nuclear tests began.

MISCELLANEOUS SURFACE WATERS

The dissolved-solids content observed in miscellaneous surface waters in 1960 ranged from 239 to 61,200 ppm (table 8). Generally, the water containing less than 500 ppm of dissolved solids was of the calcium bicarbonate type; water containing between 500 and 2,000 ppm of dissolved solids was of the sodium magnesium sulfate or the sodium magnesium bicarbonate type; and water containing more than 2,000 ppm of dissolved solids was of the sodium sulfate type.

Differences in dissolved-solids content from lake to lake probably depend on frequency of surface overflow and on amount of ground water exchange. The lakes that spill infrequently and have little or no ground-water inflow and outflow contain large quantities of dissolved solids. Evaporation, which affects the dissolved solids of water, is probably fairly uniform throughout the basin and does not cause the differences from lake to lake.

TABLE 8.—*Chemical analyses of miscellaneous surface-water*

[Results in parts per

| Reference letter (p. 32, 33) | Date of collection | Tem- pera- ture (° F.) | Silica (SiO ₂) | Iron (Fe) | Man- ganese (Mn) | Calcium (Ca) | Mag- nesium (Mg) | Sodium (Na) | Potas- sium (K) | Bicar- bonate (HCO ₃) |
|------------------------------------|-----------------------|---------------------------------|-------------------------------|--------------|------------------------|-----------------|------------------------|----------------|-----------------------|---|
| A..... | May 5, 1960 | 48 | 22 | 0.03 | 0.00 | 21 | 41 | 18 | 8.8 | 282 |
| B..... | May 10, 1960 | 52 | 16 | .01 | .00 | 24 | 118 | 169 | 35 | 698 |
| C..... | May 5, 1960 | 49 | 17 | .04 | .00 | 83 | 92 | 158 | 29 | 272 |
| D..... | May 3, 1960 | 48 | 0 | .45 | .00 | 28 | 4.4 | 21,700 | 280 | 6,090 |
| E..... | May 2, 1960 | 40 | 28 | .07 | .00 | 44 | 34 | 51 | 23 | 326 |
| F..... | May 8, 1960 | 57 | 31 | .01 | .00 | 39 | 15 | 20 | 9.4 | 194 |
| G..... | Apr. 30, 1960 | 42 | 20 | .02 | .06 | 19 | 41 | 188 | 23 | 624 |
| H..... |do..... | 42 | 16 | .02 | .00 | 13 | 93 | 2,390 | 128 | 1,560 |
| I..... | May 1, 1960 | 47 | 14 | .02 | .00 | 13 | 30 | 2,280 | 172 | 1,350 |
| J..... | July 16, 1954 | 70 | 12 | 1.02 | | 46 | 16 | 11 | 8.8 | 186 |
| K..... | Oct. 8, 1954 | | | | | 56 | 26 | 22 | | 272 |
| L..... | Apr. 15, 1955 | | | | | 43 | 20 | 20 | | 172 |
| M..... | June 25, 1955 | 75 | | | | 56 | 30 | 27 | | 248 |
| N..... | May 2, 1960 | 39 | 19 | .04 | .01 | 41 | 13 | 8.8 | 8.6 | 152 |
| O..... | June 27, 1954 | | 17 | 1.41 | | 42 | 17 | 20 | 12 | 180 |
| P..... | July 16, 1954 | 70 | 15 | 1.07 | | 43 | 18 | 18 | 12 | 190 |
| Q..... | Oct. 8, 1954 | | | | | 56 | 23 | 25 | | 258 |
| R..... | Apr. 15, 1955 | | | | | 58 | 27 | 26 | | 257 |
| S..... | June 25, 1955 | 65 | | | | 57 | 27 | 30 | | 250 |
| T..... | May 2, 1960 | 39 | 16 | .11 | .00 | 64 | 21 | 17 | 21 | 153 |
| U..... | Apr. 28, 1957 | 52 | 3.7 | 1.01 | | 57 | 116 | 218 | 60 | 390 |
| V..... | May 3, 1960 | 40 | 18 | .05 | .00 | 42 | 158 | 294 | 77 | 400 |
| W..... | May 1, 1960 | 46 | 17 | .04 | .00 | 39 | 52 | 53 | 19 | 447 |
| X..... | July 16, 1954 | 70 | | | | 48 | 19 | 15 | | 218 |
| Y..... | July 15, 1954 | 73 | 32 | 1.02 | | 84 | 37 | 53 | 29 | 236 |
| Z..... | June 25, 1955 | 69 | | | | 80 | 40 | 59 | | 228 |
| a..... | May 3, 1960 | 45 | 22 | .01 | .00 | 104 | 55 | 125 | 37 | 250 |
| b..... | July 15, 1954 | 74 | | | | 47 | 24 | 25 | | 242 |
| c..... |do..... | 73 | 11 | 1.01 | | 36 | 17 | 25 | 12 | 197 |
| d..... | Oct. 7, 1954 | | | | | 43 | 19 | 30 | | 241 |
| e..... | Apr. 14, 1955 | | | | | 37 | 16 | 23 | | 190 |
| f..... | June 25, 1955 | 72 | | | | 49 | 25 | 30 | | 270 |
| g..... | May 2, 1960 | 41 | 9.5 | .02 | .13 | 27 | 13 | 24 | 11 | 154 |
| h..... | May 5, 1960 | 46 | 14 | .06 | .00 | 65 | 61 | 248 | 20 | 285 |
| i..... | Apr. 28, 1957 | 53 | 22 | 1.01 | | 71 | 56 | 100 | 26 | 293 |
| j..... | May 3, 1960 | 40 | 21 | .03 | .00 | 37 | 54 | 115 | 29 | 193 |
| k..... | Apr. 30, 1960 | 42 | 23 | .04 | .00 | 8.6 | 21 | 638 | 75 | 1,270 |
| m..... | May 3, 1960 | 43 | 15 | .03 | .00 | 51 | 43 | 99 | 24 | 286 |
| n..... | Apr. 30, 1960 | 36 | 15 | .03 | .00 | 59 | 485 | 1,350 | 155 | 552 |
| o..... | May 1, 1960 | 45 | 16 | .03 | .00 | 27 | 21 | 26 | 8.3 | 213 |
| p..... | May 3, 1960 | 44 | 1.2 | .12 | .00 | 68 | 895 | 9,830 | 236 | 482 |
| q..... | May 5, 1960 | 47 | 12 | .06 | .07 | 65 | 56 | 174 | 20 | 180 |
| r..... | July 16, 1954 | 72 | | | | 49 | 18 | 27 | | 274 |
| s..... | Oct. 7, 1954 | | | | | 47 | 30 | 45 | | 300 |
| t..... | Apr. 15, 1955 | | | | | 45 | 19 | 25 | | 197 |
| u..... | May 2, 1960 | 41 | 12 | .03 | .00 | 32 | 21 | 35 | 18 | 166 |
| v..... | May 3, 1960 | 38 | 9.5 | .03 | .00 | 42 | 149 | 288 | 56 | 440 |
| w..... | Apr. 30, 1960 | 43 | 12 | .01 | .02 | 27 | 43 | 21 | 13 | 324 |

¹ In solution when analyzed.

CHEMICAL QUALITY OF SURFACE WATERS, DEVILS LAKE BASIN B31

samples in Devils Lake basin, June 1954 to May 1960

million except as indicated]

| Car- bonate (CO ₃) | Sulfate (SO ₄) | Chloride (Cl) | Fluo- ride (F) | Nitrate (NO ₃) | Boron (B) | Dissolved solids Calcu- lated | Residue at 180° C. | Hard- ness as CaCO ₃ | Specific conduct- ance (micro- mhos per cm at 25°C) | pH | Color |
|--------------------------------------|-------------------------------|------------------|----------------------|-------------------------------|--------------|-------------------------------------|--------------------------|---------------------------------------|---|-----|-------|
| 0 | 19 | 7.6 | 0.4 | 8.0 | 0.19 | ----- | 329 | 220 | 505 | 7.4 | 13 |
| 0 | 352 | 20 | .6 | .5 | .53 | 1,080 | 1,170 | 544 | 1,610 | 7.6 | 47 |
| 0 | 651 | 36 | .2 | 6.3 | .29 | 1,210 | 1,300 | 584 | 1,690 | 7.0 | 45 |
| 8,160 | 25,700 | 1,290 | 1.8 | 1.0 | 21 | 60,200 | 61,200 | 88 | 55,000 | 9.4 | 45 |
| 0 | 82 | 28 | .2 | 3.0 | .13 | ----- | 502 | 248 | 717 | 7.5 | 32 |
| 0 | 44 | 4.9 | .2 | .4 | .06 | ----- | 277 | 158 | 398 | 7.5 | 50 |
| 0 | 87 | 34 | .3 | .5 | .50 | ----- | 755 | 215 | 1,170 | 7.8 | 21 |
| 153 | 3,000 | 741 | .2 | 1.5 | 4.5 | 7,310 | 7,490 | 415 | 9,690 | 8.6 | 25 |
| 169 | 2,790 | 849 | .2 | 5.6 | 2.2 | 6,990 | 7,180 | 155 | 9,530 | 8.8 | 34 |
| 0 | 48 | 3.5 | .2 | 1.7 | .07 | ----- | 255 | 179 | 400 | 7.4 | ----- |
| 0 | 67 | 7.5 | ----- | ----- | ----- | ----- | 358 | 246 | 558 | 7.6 | ----- |
| 0 | 82 | 8.5 | ----- | ----- | ----- | ----- | 300 | 189 | 460 | 7.3 | ----- |
| 0 | 120 | 12 | ----- | ----- | ----- | ----- | 418 | 262 | 630 | 8.1 | ----- |
| 0 | 55 | 3.0 | .1 | .3 | .05 | ----- | 242 | 156 | 357 | 7.3 | 47 |
| 0 | 65 | 10 | .1 | .4 | .09 | ----- | 278 | 176 | 424 | 7.3 | ----- |
| 0 | 64 | 8.5 | .1 | 2.3 | .11 | ----- | 290 | 183 | 446 | 7.6 | ----- |
| 0 | 68 | 11 | ----- | ----- | ----- | ----- | 361 | 234 | 567 | 7.8 | ----- |
| 0 | 95 | 14 | ----- | ----- | ----- | ----- | 393 | 254 | 607 | 7.6 | ----- |
| 0 | 103 | 12 | ----- | ----- | ----- | ----- | 407 | 251 | 626 | 8.1 | ----- |
| 0 | 165 | 5.5 | .1 | 1.5 | .09 | ----- | 410 | 247 | 591 | 7.1 | 45 |
| 0 | 675 | 78 | .2 | 1.6 | .29 | 1,400 | 1,480 | 620 | 2,020 | 7.9 | ----- |
| 0 | 963 | 114 | .3 | 1.0 | .24 | 1,860 | 1,970 | 754 | 2,630 | 6.9 | 43 |
| 0 | 60 | 9.3 | .5 | 13 | .20 | ----- | 537 | 312 | 793 | 7.7 | 43 |
| 0 | 52 | 5.0 | ----- | ----- | ----- | ----- | 280 | 200 | 444 | 7.5 | ----- |
| 0 | 263 | 20 | .2 | 9.8 | .19 | ----- | 699 | 362 | 942 | 7.3 | ----- |
| 0 | 295 | 22 | ----- | ----- | ----- | ----- | 729 | 362 | 967 | 7.8 | ----- |
| 0 | 493 | 69 | .2 | .6 | .42 | 1,080 | 1,120 | 484 | 1,460 | 7.5 | 54 |
| 0 | 72 | 4.5 | ----- | ----- | ----- | ----- | 352 | 218 | 527 | 7.5 | ----- |
| 0 | 45 | 9.0 | .1 | 5.4 | .13 | ----- | 272 | 159 | 430 | 7.5 | ----- |
| 0 | 49 | 12 | ----- | ----- | ----- | ----- | 328 | 187 | 494 | 7.6 | ----- |
| 0 | 45 | 11 | ----- | ----- | ----- | ----- | 273 | 158 | 424 | 7.3 | ----- |
| 0 | 67 | 12 | ----- | ----- | ----- | ----- | 373 | 227 | 575 | 7.7 | ----- |
| 0 | 38 | 16 | .2 | 1.7 | .07 | ----- | 239 | 123 | 378 | 6.8 | 33 |
| 0 | 615 | 83 | .2 | 1.4 | .27 | 1,250 | 1,350 | 413 | 1,860 | 7.6 | 42 |
| 0 | 340 | 29 | .2 | 2.8 | .25 | ----- | 816 | 406 | 1,160 | 7.4 | ----- |
| 0 | 375 | 39 | .2 | 3.5 | .16 | ----- | 816 | 315 | 1,150 | 6.9 | 42 |
| 50 | 124 | 243 | .5 | .4 | 1.7 | 1,810 | 1,930 | 108 | 2,970 | 8.6 | 70 |
| 0 | 235 | 33 | .2 | 8.7 | .17 | ----- | 720 | 302 | 1,030 | 7.1 | 26 |
| 0 | 3,980 | 619 | .2 | 6.3 | 2.3 | 6,940 | 7,370 | 2,140 | 8,440 | 7.4 | 45 |
| 0 | 37 | 3.0 | .3 | 3.1 | .11 | ----- | 268 | 154 | 413 | 7.0 | 35 |
| 103 | 21,600 | 2,210 | .2 | .6 | 7.7 | 35,200 | 37,300 | 3,850 | 34,800 | 8.8 | 41 |
| 0 | 564 | 60 | .1 | .5 | .26 | 1,040 | 1,150 | 393 | 1,500 | 6.9 | 28 |
| 0 | 27 | 8.0 | ----- | ----- | ----- | ----- | 312 | 197 | 491 | 7.6 | ----- |
| 0 | 100 | 3.5 | ----- | ----- | ----- | ----- | 473 | 241 | 695 | 7.6 | ----- |
| 0 | 82 | 12 | ----- | ----- | ----- | ----- | 329 | 192 | 491 | 7.2 | ----- |
| 0 | 105 | 11 | .1 | 1.0 | .08 | ----- | 365 | 167 | 527 | 6.8 | 32 |
| 0 | 876 | 108 | .3 | 2.9 | .57 | 1,740 | 1,860 | 718 | 2,460 | 7.3 | 44 |
| 0 | 39 | 4.6 | .4 | .4 | .09 | ----- | 338 | 246 | 550 | 7.8 | 12 |

Continued on next page.

| Reference letter | Lake or stream | Sampling point | | |
|------------------|--|----------------|------------|---|
| | | Township (N.) | Range (W.) | Section |
| A..... | Battle Lake near Warwick..... | 150 | 62 | 17 NE $\frac{1}{4}$ SE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| B..... | Broken Bone Lake near Pleasant Lake..... | 156 | 71 | 9 SW $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| C..... | Coon Lake near Lakota..... | 152 | 60 | 19 NE $\frac{1}{4}$ NE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| D..... | Cranberry Lake near Fillmore..... | 154 | 71 | 27 SE $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| E..... | Dry Lake near Webster..... | 155 | 65 | 10 NE $\frac{1}{4}$ NE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| F..... | Edmore Coulee near Webster..... | 156 | 63 | 13 SE $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| G..... | Elbow Lake near Warwick..... | 151 | 63 | 17 NE $\frac{1}{4}$ SE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| H..... | Free Peoples Lake near Warwick..... | 151 | 63 | 8 SE $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| I..... | Horseshoe Lake near Warwick..... | 151 | 64 | 36 SE $\frac{1}{4}$ SE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| J-M..... | Lac Aux Mortes near Churchs Ferry..... | 156 | 66 | 21 NE $\frac{1}{4}$ NE $\frac{1}{4}$ NW $\frac{1}{4}$ |
| N..... | do..... | 156 | 66 | 11 NE $\frac{1}{4}$ NW $\frac{1}{4}$ NE $\frac{1}{4}$ |
| O-S..... | Lake Irvine near Churchs Ferry..... | 156 | 66 | 32 SE $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| T..... | do..... | 156 | 66 | 32 NE $\frac{1}{4}$ NE $\frac{1}{4}$ SW $\frac{1}{4}$ |
| U-V..... | Long Lake near Minnewaukan..... | 152 | 67 | 8 NE $\frac{1}{4}$ NE $\frac{1}{4}$ NE $\frac{1}{4}$ |
| W..... | Mallard Lake near Tokio..... | 151 | 64 | 13 NW $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| X..... | Mauvais Coulee at inlet to Lac Aux Mortes..... | 156 | 66 | 2 NE $\frac{1}{4}$ NW $\frac{1}{4}$ NW $\frac{1}{4}$ |
| Y..... | Morrison Lake near Sweetwater..... | 155 | 64 | 23 NW $\frac{1}{4}$ NE $\frac{1}{4}$ |

SALTS IN THE BEDS AND SHORES OF THE MAJOR LAKES

From 1899 to 1948, while Devils Lake receded and then began to rise again, the weight of dissolved salts decreased to one-fourth the original weight because of precipitation of salts on the lake shores and probably on the lakebed. Although the relationship is not well defined, an increase in water volume during 1949-60 generally was associated with an increase in the weight of dissolved salts because salt was added to the lake by runoff and by solution of previously precipitated salts (fig. 9). The apparent decrease in salt tonnage while the lake volume was increasing in 1956 probably was caused by incomplete sampling of non-uniform water during the time of relatively rapid lake fluctuation.

Salt balances were prepared for Devils Lake, East Devils Lake, and eastern and western Stump Lakes to determine the weight of salts added to or removed from the beds and shores. The salt balance for Devils Lake, including Sixmile and Creel Bays, was determined from the volume of water and the dissolved solids from Big Coulee, the volume of water and the dissolved solids in Devils Lake, and the estimated volume of water and the dissolved solids entering East Bay. The net weight of salts added to or removed from the beds and shores was calculated with the following salt-balance equation:

FOR TABLE 8

| Reference letter | Lake or stream | Sampling point | | |
|------------------|--------------------------------------|----------------|------------|---|
| | | Township (N.) | Range (W.) | Section |
| Z----- | Morrison Lake near Sweetwater----- | 155 | 64 | 15 NE $\frac{1}{4}$ |
| a----- | Pelican Lake marsh near Minnewaukan. | 154 | 67 | 24 SE $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| b----- | Rock Lake near Rock Lake----- | 162 | 66 | 15 SW $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| c-g----- | do----- | 161 | 66 | 7 NE $\frac{1}{4}$ NE $\frac{1}{4}$ SW $\frac{1}{4}$ |
| h----- | Rose Lake near Bartlett----- | 152 | 61 | 10 SW $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| i-j----- | Round Lake near Minnewaukan----- | 153 | 67 | 35 NE $\frac{1}{4}$ NW $\frac{1}{4}$ SE $\frac{1}{4}$ |
| k----- | Shinbone Lake at Warwick----- | 151 | 63 | 34 SW $\frac{1}{4}$ NE $\frac{1}{4}$ NW $\frac{1}{4}$ |
| m----- | Silver Lake near Brinsmade----- | 154 | 67 | 3 NE $\frac{1}{4}$ SW $\frac{1}{4}$ NE $\frac{1}{4}$ |
| n----- | Spring Lake near Tokio----- | 152 | 64 | 35 SE $\frac{1}{4}$ NW $\frac{1}{4}$ NE $\frac{1}{4}$ |
| o----- | Square Lake near Tokio----- | 151 | 64 | 11 SE $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| p----- | Stink Lake near Churchs Ferry----- | 155 | 67 | 11 SE $\frac{1}{4}$ NW $\frac{1}{4}$ NE $\frac{1}{4}$ |
| q----- | Swan Lake near Bartlett----- | 152 | 61 | 26 NW $\frac{1}{4}$ NW $\frac{1}{4}$ NW $\frac{1}{4}$ |
| r----- | Sweetwater Lake near Sweetwater----- | 155 | 63 | 30 SE $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| s-t----- | do----- | 155 | 64 | 24 NW $\frac{1}{4}$ SE $\frac{1}{4}$ SE $\frac{1}{4}$ |
| u----- | Sweetwater Lake at Sweetwater----- | 155 | 64 | 27 SE $\frac{1}{4}$ SW $\frac{1}{4}$ SW $\frac{1}{4}$ |
| v----- | Twin Lakes near Fort Totten----- | 152 | 66 | 22 NE $\frac{1}{4}$ SW $\frac{1}{4}$ SE $\frac{1}{4}$ |
| w----- | Wood Lake near Tokio----- | 151 | 64 | 16 NE $\frac{1}{4}$ NE $\frac{1}{4}$ NE $\frac{1}{4}$ |

$$x = (t_i - t_o) - (T_2 - T_1)$$

where

- x is net tons added to or removed from the bed. A positive (+) value indicates a net addition of salts, and a negative (—) value indicates a net removal of salts.
- t_i is tons in inflow.
- t_o is tons in outflow.
- T_2 is tons in solution in the lake at the end of the period.
- T_1 is tons in solution in the lake at the beginning of the period.
- $(t_i - t_o)$ is the change in the weight of salts in the lake during a given period if salts are not added to or removed from the lakebed.
- $(T_2 - T_1)$ is the change in weight of salts in the lake and equals the weight of salts added to or removed from the lake if no inflow or outflow occurs.

For the 9 years of record shown in table 9, the annual net change of the weight of salts in the bed of Devils Lake ranged from +30,000 to -89,000 tons. The annual average weight of salts removed from the bed per unit area was 2.7 tons per acre; solution of these salts increased the average annual concentration by 193 ppm. The calculated net changes of the weight of salt in the bed of Devils Lake for each of the

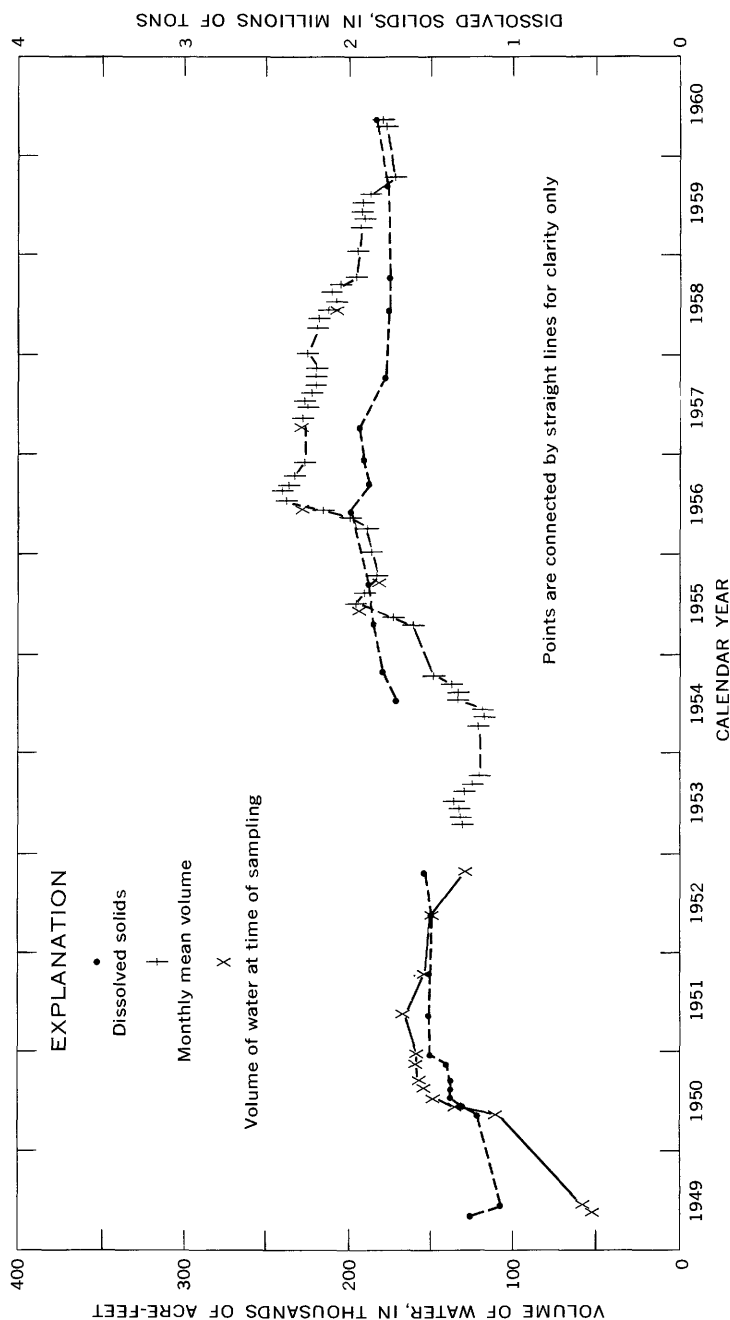


FIGURE 9.—Volume of water and concentration of dissolved solids in the water in Devils Lake, 1949-60.

9 years are of the same order of magnitude even though T_2 and T_1 in the salt balance are large compared with their difference, and small errors in T_2 and T_1 could have caused large relative errors in their difference. None of the calculated increases of concentration from solution of salts increased the concentration by more than about 5 percent.

Preparation of salt balances for East Devils, western Stump, and eastern Stump Lakes required certain assumptions and estimates. Because inflows to the lakes were not measured, an average runoff of 0.2 inch per year was assumed and a drainage area for each lake was estimated. After the volume of inflow for each lake was calculated, an estimated concentration of 0.14 ton per acre-foot (about 100 ppm) was assumed and the weight of salts in the inflow was calculated. This assumed concentration for the runoff is not unreasonable when the concentrations for Big Coulee at high flow are considered. Except for western Stump Lake, the weight of salts contributed annually by inflow is small compared with the weight change in the lake. Two-tenths inch per year is a reasonable estimate for average runoff in the area; Swenson and Colby (1955) reported 0.23 inch per year as a 22-year average for the area around Sheyenne, N. Dak., which they considered to be comparable with the Devils Lake area. Because there was no outflow from the lakes during the $8\frac{1}{2}$ -year period, t_o was zero in all three balances. The salt balances for the three lakes and the estimated drainage areas used in calculating t_i are summarized in table 10.

TABLE 9.—Yearly salt balances for Devils Lake, including Sismile Bay and Creel Bay

| Water year..... | 1952 | 1953 | 1954 | 1955 | 1956 | 1957 | 1958 | 1959 | 1960 |
|--|---------|---------|----------|---------|---------|---------|---------|---------|---------|
| Dissolved salts entering lake from Big Coulee (i_s)..... | 8 | 0 | 15,800 | 24,000 | 23,800 | 747 | 76 | 54 | 176 |
| Increase (+) or decrease (—) in quantity of dissolved salts in lake ($T_2 - T_1$)..... | 0 | +85,000 | +105,000 | 0 | +58,000 | 149,000 | 12,300 | 0 | 0 |
| Salts removed from (—) or added to (+) lakebed (z)..... | +41,000 | —85,000 | —89,000 | +58,000 | +8,000 | —73,000 | —17,000 | +35,000 | —30,000 |
| Average area of lakebed covered by water..... | 15,120 | 13,660 | 14,020 | 16,450 | —59,000 | —75,000 | +5,000 | —35,000 | +30,000 |
| Salts removed from (—) or added to (+) lakebed per unit area..... | —2.7 | —6.2 | —6.3 | —2.1 | 17,860 | 18,320 | 17,900 | 17,280 | 16,820 |
| Increase (+) or decrease (—) of dissolved solids in lake..... | +220 | +520 | +440 | +140 | —3.3 | —4.1 | +3 | —2.0 | +1.8 |
| Dissolved solids in lake at end of water year..... | 8,680 | 10,330 | 8,830 | 7,410 | 5,820 | 5,970 | 6,650 | 7,610 | 8,230 |
| Volume of water in lake at end of water year..... | 135,000 | 120,000 | 149,000 | 183,000 | 234,000 | 219,000 | 195,000 | 174,000 | 163,000 |

TABLE 10.—*Estimated salt balances for East Devils and western and eastern Stump Lakes, May 1952 to September 1960*

| Lake..... | | East Devils | Western Stump | Eastern Stump |
|---|--------------------|----------------|------------------|------------------|
| Drainage area..... | acres..... | 32,000 | 224,000 | 32,000 |
| Dissolved salts in inflow (I_1)..... | tons..... | 600 | 4,400 | 600 |
| Dissolved salts in lake at end of 8½-year period (T_2)..... | do..... | 512,000 | 62,600 | 1,040,000 |
| Dissolved salts in lake at beginning of 8½-year period (T_1)..... | do..... | 712,000 | 73,300 | 1,460,000 |
| Salts added to lakebed (x)..... | do..... | 201,000 | 15,100 | 421,000 |
| Do..... | tons per acre..... | 90 | 11 | 170 |

Laboratory examinations were made of bed and shore materials to determine the relative abundance of soluble salts in the two types of material and to determine the chief constituents of the soluble salts. Samples for examination were taken with a core type sampler, or in the case of some shore samples, a hand shovel. Generally, they were taken from the top several inches of bed or shore material only; however, some for eastern Stump Lake were taken at several depths below the bed.

The results of the laboratory examinations are given in table 11 and were obtained as follows. A weighed fraction of each sample was put into a measured volume of distilled water and was shaken mechanically for 72 hours. The amount of salt dissolved was then measured. A second weighed fraction was oven dried at 180° C for 1 hour, was reweighed to determine moisture loss, was heated in a platinum dish over an intense flame to destroy organic matter, and was then weighed again. Because of various amounts of moisture and organic matter in the samples, the results are reported in unit weights of salt dissolved per unit weight of dry, inorganic bed or shore material.

Data in table 11 indicate that the shore material has less soluble salt than bed material by at least one order of magnitude. In the table, material 0.5 foot above the water surface is considered as bed material. Undoubtedly, material at such a slight altitude above the water surface is frequently inundated by wave action and the salt content of the material, therefore, is likely to be more akin to that of the bed than that of the shore at a higher altitude.

The laboratory results in table 11 do not necessarily indicate the amount of salt that will actually be dissolved from the bed or shore material should the lake volumes increase. Langbein (1961) stated that although the beds of closed lakes may contain readily soluble salts, some of these salts may be trapped in mud and so insulated from the lake water that they may be unavailable for re-solution. Also, the samples in the laboratory were thoroughly dispersed in the water by the mechanical shaking, and more salts probably dissolved from them than would have dissolved under natural conditions.

TABLE 11.—*Weight of salts available from bed and shore material*

[Calculated from samples leached in laboratory]

| Sam- pling site (see pl. 1) | Description of sample | Date of collection | Area rep- resented by sample (acres) | Salts avail- able from bed or shore material (tons per ton of dry, inorganic material) | Altitude (feet) |
|--|---|-----------------------|---|---|--------------------|
| Big Coulee near Grahams Island | | | | | |
| 1 | {Shore material 10 ft above water surface..... | Apr. 29, 1960 | 2, 400 | 0.000688 | 1, 426 |
| | {Bed material from coulee..... | Oct. 5, 1959 | 4, 020 | .0504 | 1, 415 |
| Devils Lake, Creel Bay, and Mission Bay | | | | | |
| 11 | Bed material 6 ft below water surface..... | Oct. 4, 1959 | 17, 120 | 0.0102 | ----- |
| 16 | Shore material 10 ft above water surface..... | Apr. 29, 1960 | 2, 780 | .000933 | ----- |
| 25 | Shore material 10 ft above water surface..... | do..... | 2, 780 | .000952 | ----- |
| 27 | Bed material 3.3 ft below water surface..... | Oct. 1, 1959 | 17, 120 | .0102 | ----- |
| 32 | Bed material 4.5 ft below water surface..... | Oct. 4, 1959 | 17, 120 | .00785 | ----- |
| 35 | Bed material 4.5 ft below water surface..... | Oct. 5, 1959 | 17, 120 | .0107 | ----- |
| 41 | Bed material 5.4 ft below water surface..... | Oct. 2, 1959 | 650 | .0619 | ----- |
| | Average for shore material (weighted by area)..... | ----- | ----- | .00943 | ----- |
| | Average for bed material (weighted by area)..... | ----- | ----- | .0102 | ----- |
| East Bay and Black Tiger Bay | | | | | |
| 44 | Bed material 0.3 ft below water surface..... | June 16, 1960 | 8, 000 | 0.0425 | ----- |
| | {Bed material from dry lakebed..... | Apr. 29, 1960 | 8, 000 | .0816 | ----- |
| 45 | {Shore material 20 ft above dry lakebed..... | do..... | 2, 340 | .000624 | 1, 430 |
| | {Shore material 5 ft above dry lakebed..... | do..... | 3, 530 | .00504 | 1, 415 |
| 46 | {Bed material 1.5 ft below water surface..... | June 16, 1960 | 8, 000 | .0182 | ----- |
| | {Bed material 0.5 ft above water surface..... | do..... | 8, 000 | .0356 | ----- |
| 47 | {Bed material 0.5 ft above water surface..... | Oct. 3, 1959 | 610 | .113 | ----- |
| 48 | {Bed material 0.5 ft below water surface..... | June 17, 1960 | 8, 000 | .0480 | ----- |
| | {Bed material 0.5 ft above water surface..... | do..... | 8, 000 | .0841 | ----- |
| | Average for bed material (weighted by area)..... | ----- | ----- | .0524 | 1, 410 |
| East Devils Lake | | | | | |
| 49 | {Shore material 20 ft above water surface..... | May 7, 1960 | 580 | 0.00188 | 1, 421 |
| | {Shore material 10 ft above water surface..... | do..... | 1, 300 | .00154 | 1, 411 |
| 55 | Bed material 4.0 ft below water surface..... | Oct. 3, 1959 | 2, 320 | .326 | 1, 396 |
| Western Stump Lake | | | | | |
| 62 | Bed material 1.5 ft below water surface..... | May 6, 1960 | 2, 280 | 0.0270 | ----- |
| 64 | Bed material 0.7 ft below water surface..... | do..... | 2, 280 | .0225 | ----- |
| | {Bed material 0.0 ft below water surface..... | do..... | 2, 280 | .0136 | ----- |
| 65 | {Shore material 20 ft above water surface..... | do..... | 1, 580 | .000987 | 1, 416 |
| | {Shore material 5 ft above water surface..... | do..... | 980 | .00312 | 1, 401 |
| | Average for bed material (weighted by area)..... | ----- | ----- | .0210 | 1, 394-96 |
| Eastern Stump Lake | | | | | |
| 69 | Bed material 1.5 ft below water surface..... | June 15, 1960 | 1, 350 | 0.177 | ----- |
| 73 | Bed material 5.5 ft below water surface..... | do..... | 1, 160 | .835 | ----- |
| 75 | Bed material 4.3 ft below water surface..... | Oct. 9, 1959 | 1, 160 | .965 | ----- |
| | {Bed material 1.5-2.0 ft below lakebed surface..... | June 15, 1960 | 1, 160 | .107 | ----- |
| 76 | {Bed material 1.0-1.5 ft below lakebed surface..... | do..... | 1, 160 | .171 | ----- |
| | {Bed material 0.5-1.0 ft below lakebed surface..... | do..... | 1, 160 | .169 | ----- |
| | {Bed material 0.0-0.5 ft below lakebed surface..... | do..... | 1, 160 | .452 | ----- |
| | {Bed material 1.2-1.7 ft below lakebed surface..... | do..... | 1, 160 | .0572 | ----- |
| | {Bed material 0.8-1.2 ft below lakebed surface..... | do..... | 1, 160 | .0774 | ----- |
| | {Bed material 0.5-0.8 ft below lakebed surface..... | do..... | 1, 160 | .309 | ----- |
| 77 | {Bed material 0.0-0.5 ft below lakebed surface..... | do..... | 1, 160 | .736 | ----- |
| | {Bed material 0.7-1.0 ft below lakebed surface..... | do..... | 1, 350 | .123 | ----- |
| | {Bed material 0.0-0.7 ft below lakebed surface..... | do..... | 1, 350 | .171 | ----- |
| | {Shore material 20 ft above water surface..... | May 7, 1960 | 770 | .000930 | 1, 404 |
| 78 | {Shore material 5 ft above water surface..... | do..... | 320 | .000851 | 1, 389 |
| 80 | Bed material 0.9 ft below water surface..... | June 15, 1960 | 1, 350 | .186 | ----- |
| | Average for bed material (weighted by area)..... | ----- | ----- | .178 | 1, 379-83 |
| | Average for bed material (weighted by area)..... | ----- | ----- | .747 | 1, 378-81 |

Calcium, bicarbonate, and carbonate were the predominant water soluble constituents in the leachate from the bed material from Devils Lake. Most of the bicarbonate ion probably came from the water in the bed material, but some bicarbonate probably was derived from precipitated calcium carbonate. Sodium and sulfate were the predominant constituents in the bed material from East Bay, East Devils Lake, and eastern and western Stump Lakes. Generally, calcium and bicarbonate were the predominant constituents in the shore material from all the lakes, probably because little sodium sulfate was precipitated from solution during high lake levels and because the more soluble sodium sulfate was leached from the shores by runoff.

Data in tables 9 and 11 provide at least a partial answer to the question posed by Swenson and Colby (1955, p. 60) as to whether the large quantities of salt that "disappeared" from Devils Lake between 1923 and 1948 would redissolve if the altitudes are increased. During 1954 and 1955 the lake altitude increased from less than 1,412 feet to more than 1,416 feet (fig. 1), the altitude of the lake in 1923. This increase in lake altitude was accompanied by removal from the bed of only about 123,000 tons of salt, a rather small amount compared with the estimate of more than 2,500,000 tons that "disappeared."

In 1956 the lake altitude increased by about another 3 feet, to more than 1,419. As a result of this increase in altitude, some land was inundated that probably had not been inundated for approximately 40 years. Nevertheless, during 1956 and 1957, when pickup of salts from the bed was still proceeding rapidly, a total of only about 134,000 tons was removed from the bed. Probably not even all of this tonnage, however, was actually from the newly submerged part of the bed.

Re-solution of salts from a lakebed may be a slow process that can continue for a long time following a significant increase in lake altitude. Although the maximum altitude of Devils Lake was reached in 1956, much re-solution must have taken place the following year because more salts actually were removed from the lakebed in 1957 than in 1956. How long re-solution might continue following an increase in altitude of Devils Lake is conjectural; however, evidence in table 9 indicates that the re-solution following the significant increase of 1956 ceased for all practical purposes sometime during the 1958 water year.

What portions of salts that "disappeared" from Devils Lake in earlier years will eventually redissolve if the altitude of Devils Lake is restored cannot be determined accurately from the present evidence. However, it would be small, probably only about 10-20 percent.

EFFECT OF LAKE LEVELS ON THE QUALITY OF WATER

If lake levels remain low, the concentration of dissolved solids will increase. Sodium sulfate probably will increase in relation to the other salts except in eastern Stump Lake, which is saturated or almost saturated with sodium sulfate.

If lake levels rise, the total quantity of salts dissolved in the lakes will increase. However, the concentration of dissolved solids in the lakes will decrease because the runoff causing the rise will contain a lower concentration of dissolved solids than the lakes. As bicarbonate is the principal anion in the runoff entering the lakes, the calcium bicarbonate dissolved in the lakes will increase in relation to sodium sulfate.

A rise in lake levels could affect ground-water movement. If ground water moved away from the lake, zinc probably would not accumulate in the lakes. If ground water moved into the lakes, zinc could be added to the lakes. Owing to a decrease in sulfate reduction, this zinc probably would remain in the water. If lake levels remained high or if an outlet for the lakes were established, the zinc concentration probably would not increase significantly.

SUMMARY

Water budget computations indicate that for most water years between 1952 and 1960 the volume of Devils Lake decreased by about 10,000–23,000 acre-feet, mostly because of evaporation. In the 1954, 1955, and 1956 water years, however, the volume increased by 29,000, 34,200 and 51,100 acre-feet, respectively. In response to these increases in water volume, the water-surface altitude, which was only about 1,411.6 feet in the early part of the 1954 water year, rose to about 1,419.3 feet in the late part of the 1956 water year. This was the highest altitude the lake is known to have attained since about 1915.

A flow-duration curve for Big Coulee, which supplies most of the flow into Devils Lake, resembles that of a typical ephemeral stream except for discharges greater than 300 cfs. At discharges greater than 300 cfs, flow duration is altered by regulation from upstream lakes. Water from Big Coulee in 1952–60 was of the calcium bicarbonate type except when discharge was extremely low (about 0.1 cfs), and most of it contained less than 600 ppm of dissolved solids. About 76 percent of the water that entered Devils Lake from Big Coulee during the period did so when discharges were in excess of 100 cfs.

Water from Sixmile Bay, Creel Bay, and the main part of Devils Lake is free to intermingle, and chemical analyses indicate that the quality of the water in the three places generally is similar. Dissolved-solids concentrations averaged about 6,500 ppm for the period 1954–60 but were somewhat less for the period 1954–56, when lake altitudes were relatively high.

Mission Bay is connected to Devils Lake and East Bay to Mission Bay by culverts. Lack of free movement of water, intermittent flushing of salts from the water body upgradient, and evaporation have caused Mission Bay and East Bay to have somewhat higher dissolved solids than Sixmile Bay, Creel Bay, or the main part of Devils Lake. During much of the 1952-60 period, East Bay had so little water that it could not be sampled satisfactorily.

East Devils Lake received no water from East Bay from 1952 to 1960. The water surface, however, probably was maintained at about the same altitude as in the 1950-52 period by local runoff. The dissolved solids from 1952 to 1960 are estimated to have averaged about 60,700 ppm, nearly as much as the greatest concentration measured in 1950-52. The water in East Devils Lake had higher proportions of sodium and of sulfate than water from any of the other lakes in the Devils Lake chain.

Water from most of the Stump Lake drainage area flows into western Stump Lake, which is connected to eastern Stump Lake by culvert. Although water moves from time to time from western Stump Lake into eastern Stump Lake, this probably did not happen from 1952 to 1960. Because the eastern lake occasionally receives dissolved solids flushed from the western lake, it has accumulated much more of the dissolved solids. During 1956-60, dissolved solids averaged 23,100 ppm for western Stump Lake, but 127,000 ppm for eastern Stump Lake.

Water in eastern Stump Lake was saturated or nearly saturated with sodium sulfate. In the fall and winter, a thick layer of granular, hydrated sodium sulfate crystals formed on the lakebed and along the shore. As water temperatures increased in late spring and summer, the granular crystals disappeared; however, a discontinuous layer of consolidated sodium sulfate crystals several inches thick formed a significant part of the bed during the summer also.

Small amounts of zinc, copper, lead, iron, manganese, fluoride, arsenic, boron, and phosphate were detected in the water in Devils Lake. The source of these constituents has not been studied, but the most likely source of zinc is ground water.

The dissolved-solids content observed in water from 29 miscellaneous lakes in 1960 ranged from 239 to 61,200 ppm. Water containing low dissolved solids was of the calcium bicarbonate type; water containing high dissolved solids was of the sodium sulfate type. Differences in dissolved-solids content from one lake to another probably depend on frequency of overflow and amount of ground-water inflow.

As the volume of water increased in Devils Lake from 1949-60, the annual average weight of salts removed from the bed of the lake was 2.7 tons per acre, and the annual average addition of salts to the water in the lake was 193 ppm. The shores contained less weight of salt per

unit weight of dry, inorganic material than the lakebed. Calcium, carbonate, and bicarbonate were the predominant water soluble constituents in bed material from Devils Lake. Sodium and sulfate, however, were the predominant soluble constituents in bed material from East Bay, East Devils Lake, and eastern and western Stump Lakes. Generally, calcium and bicarbonate were the predominant soluble constituents in the shore material from all the lakes.

Probably not more than 20 percent of the large quantity of salt that "disappeared" from the water of Devils Lake many years ago will redissolve if the altitude of the lake west of State Route 20 is restored. An increase in altitude from 1,412 to 1,416 feet during 1954 and 1955 resulted in removal from the lakebed of only about 123,000 tons of salt. A further increase in altitude from 1,416 to 1,419 feet in 1956 resulted in the removal of an additional 134,000 tons. This total of 257,000 tons removed from the bed is small compared with the more than 2,500,000 tons that Swenson and Colby (1955) estimated "disappeared" between 1923 and 1948.

LITERATURE CITED

- Abbott, G. A., 1925, A chemical investigation of the water in Devils Lake, North Dakota : *Indiana Acad. Sci. Proc.*, v. 34, p. 181-184.
- Abbott, G. A., and Voedisch, F. W., 1938, The municipal ground water supplies of North Dakota : *North Dakota Geol. Survey Bull.* 11, 99 p.
- Aronow, Saul, 1957, On the postglacial history of the Devils Lake region, North Dakota : *Jour. Geology*, v. 65, no. 4, p. 410-427.
- Fenneman, N. M., 1938, *Physiography of the eastern United States* : New York, McGraw-Hill Book Co., Inc., 714 p.
- Horton, R. E., 1943, Evaporation maps of the United States : *Am. Geophys. Union Trans.*, pt. 2, p. 743-753.
- Kohler, M. A., Nordenson, T. J., and Baker, D. R., 1959, Evaporation maps for the United States : *U.S. Weather Bur. Tech. Paper* 37, 13 p., 5 pls.
- Langbein, W. B., 1961, Salinity and hydrology of closed lakes : *U.S. Geol. Survey Prof. Paper* 412, 20 p.
- Lemke, R. W., 1960, Geology of the Souris River area, North Dakota : *U.S. Geol. Survey Prof. Paper* 325, 138 p.
- McKee, J. E., and Wolf, H. W., eds., 1963, *Water quality criteria* [2d ed.] : California Water Quality Control Board Pub. 3-A, 548 p.
- Paulson, Q. F., and Akin, P. D., 1964, Ground-water resources of the Devils Lake area, Benson, Ramsey, and Eddy Counties, North Dakota : *North Dakota State Water Conserv. Comm.*, *North Dakota Ground-Water Studies* 56, 211 p.
- Simpson, H. E., 1929, Geology and ground-water resources of North Dakota : *U.S. Geol. Survey Water-Supply Paper* 598, 312 p.
- Swenson, H. A., and Colby, B. R., 1955, Chemical quality of surface waters in Devils Lake basin, North Dakota : *U.S. Geol. Survey Water-Supply Paper* 1295, 82 p.
- U.S. Bureau of Reclamation, 1961, Supplemental report on Garrison diversion unit : Missouri-Souris Proj. Office, Bismarck, N. Dak.
- U.S. Congress, 1944, Missouri River basin : *U.S. 78th Cong., 2d Sess.*, 211 p.