



Maped, edited, and published by the Geological Survey  
Control by USGS  
Topography from aerial photographs by multiplex methods  
Aerial photographs taken 1945. Field check 1948  
Polyconic projection. 1927 North American datum  
10,000 foot grid based on Pennsylvania coordinate system,  
north zone  
1000 meter Universal Transverse Mercator grid  
zone 17

SCALE 1:250,000

ROAD CLASSIFICATION  
HEAVY DUTY ALL WEATHER ROADS Improved dirt  
MEDIUM DUTY Unimproved dirt  
LIGHT DUTY GRAVEL OR MARSH HARD SURFACE  
STATE ROUTE STATE ROUTE

CROSBY, PA.  
M4137 S. W. 7622  
1948

Landslides and related features interpreted  
from aerial photographs:  
1:78,000 (black and white) 1977  
  
Photointerpretation and field check 1978-1979  
This map has not been edited or reviewed  
for conformity with Geological Survey  
standards and nomenclature.

LANDSLIDES AND RELATED FEATURES

OF THE CROSBY, PA. QUADRANGLE

by  
John S. Pomeroy  
1981

U.S. Geological Survey  
OPEN FILE MAP 81-238 (F-13)

NOTE  
Information shown is intended as a  
general guide to ground conditions as of  
the date of field check. Additional  
landslides and rockfalls should be anticipated  
in all map units. The map unit depicts  
the dominant condition in the area delineated  
and variations in slope stability may occur  
at any point in the unit. This map is suitable  
for general planning purposes and as a  
supplement to more detailed studies for site  
selection. The map cannot be used as a  
substitute for detailed geologic and engineering  
investigations to establish design and  
construction criteria of specific sites.  
Some symbols may not appear on this map  
because the description is applicable to a  
series of maps.

MAN-MADE FEATURES

- Strip mines (combination of letter symbols indicates complex formed of more than one type of strip mine)
  - sh bench with high wall
  - sf furrowed with high wall
  - sd multiple furrows and multiple benches
  - ss hilltop removed
  - srg reclaimed by grading
  - sru reclaimed by secondary use
  - sh/r reclaimed in part, high wall remains
- Coal refuse banks
  - r identified on aerial photographs; not classified in field check
  - rb not burnt nor on fire
  - rbb burnt
  - rbd burning
  - rbs sludge
- Quarries
  - q quarry site
  - qub spoil bank, quarry waste
- Gravel pits
  - g site of gravel pit
- Slides in man-made features
  - af earth flow in fill
  - a/s earth flow in strip castings
  - a/r earth flow in coal refuse


- A** ACTIVE OR RECENTLY ACTIVE LANDSLIDE  
Complex landslide composed of earthflow, debris slide, earth and rock slump. Identified from historical records, and from scars, debris and other field evidence. Ground extremely unstable; sliding accelerated by excavation, loading and changes in drainage conditions. May include areas with several active slides too small to be shown separately. Questioned where doubtful. May be shown with symbol (A) where difficult to discern.
- O** OLD LANDSLIDE  
Area of extensive hummocky ground caused by earthflow and earth and rock slump. Lacks clear evidence of active sliding. Relatively stable in natural, undisturbed state, generally not affected by small structures properly sited in areas away from the edge of the toe; can be reactivated by extensive, rapid excavation, loading, and changes in ground water and surface water conditions. Area of old landslide probably includes recent ones not identified from field evidence or otherwise documented. Upslope boundary of landslide generally defined by modified scarp, but downslope (toe) may be gradational and not well defined. Questioned where doubtful.
- V** COLLUVIAL SLOPE  
Valley wall along major streams with slope as steep as 40° (85%); stony, clayey silt soil up to 50 ft. (15 m) thick; commonly buttressed by a terrace or bench at the toe of the slope; very susceptible to sliding by cutting of toe area, removal of terrace or bench, and overloading; slide commonly activated without apparent cause.

- la** AREAS SUSCEPTIBLE TO DEBRIS FLOWS AND DEBRIS AVALANCHES  
Primarily shallow, narrow ravines and chutes with accumulation of stony colluvium generally 10 ft. (3 m) or less in thickness; susceptible to rapid movement during intense rainfall. Most ravines and chutes designated show evidence of former debris flows and avalanches. Symbol la designates historical debris flow or debris avalanche.
- ra** AREAS SUSCEPTIBLE TO ROCKFALL  
Steep, locally vertical, natural and man-made slopes and cliffs, 15 ft. (4.5 m) or more high; formed dominantly of sandstone, limestone, sandy shale, mudstone and claystone. Interbedded mudstone, claystone and shale weather rapidly leaving sandstone and limestone rock faces unsupported.

- sa** SOIL AND ROCK SUSCEPTIBLE TO LANDSLIDING  
Soil and rock similar to that involved in landslides elsewhere in map area; primarily areas underlain by claystone, mudstone and shale associated with other rock types. Rock weathers rapidly on exposure forming clayey soil highly susceptible to sliding. Includes coves (U-shaped, shallow valleys) containing thick layers of clayey soil that are very susceptible to sliding where excavation breaks continuity of slope and where overloaded by artificial fill.

AREAS LEAST PRONE TO LANDSLIDES  
Map areas in which no patterns or symbols are shown; primarily valley floors, ridge tops and broad benches; modification by excavation and fill may lead to local landslides.  
Includes slopes where landslides are sparse.

The first five digits of the open file number designate the specific 1:250,000 scale map sheet of which this quadrangle is a part. The last two digits designate the position of the quadrangle in a subdivision of the 1:250,000 scale map based on rows and tiers shown in the diagram to the right. The location of this quadrangle is shown by the black square.

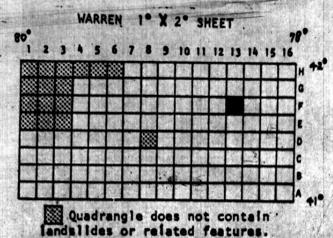

Quadrangle does not contain landslides or related features.