



H. VIEW SOUTH FROM NORTH RIM OF CANYON OF ENTIRE LANDSLIDE



G. SECONDARY SLUMP BELOW LOWER BENCH



F. COTTONWOOD RESERVOIR



E. SCARP ON RIGHT FLANK OF LANDSLIDE




D. UPPER RAMP



C. DEBRIS-FLOW DEPOSITS



A. VIEW OF UPPER COMPLEX SLUMPS FROM BELOW  
Note smear of deposit from debris-flow to right of center of view. Person on debris-flow deposit in foreground gives scale

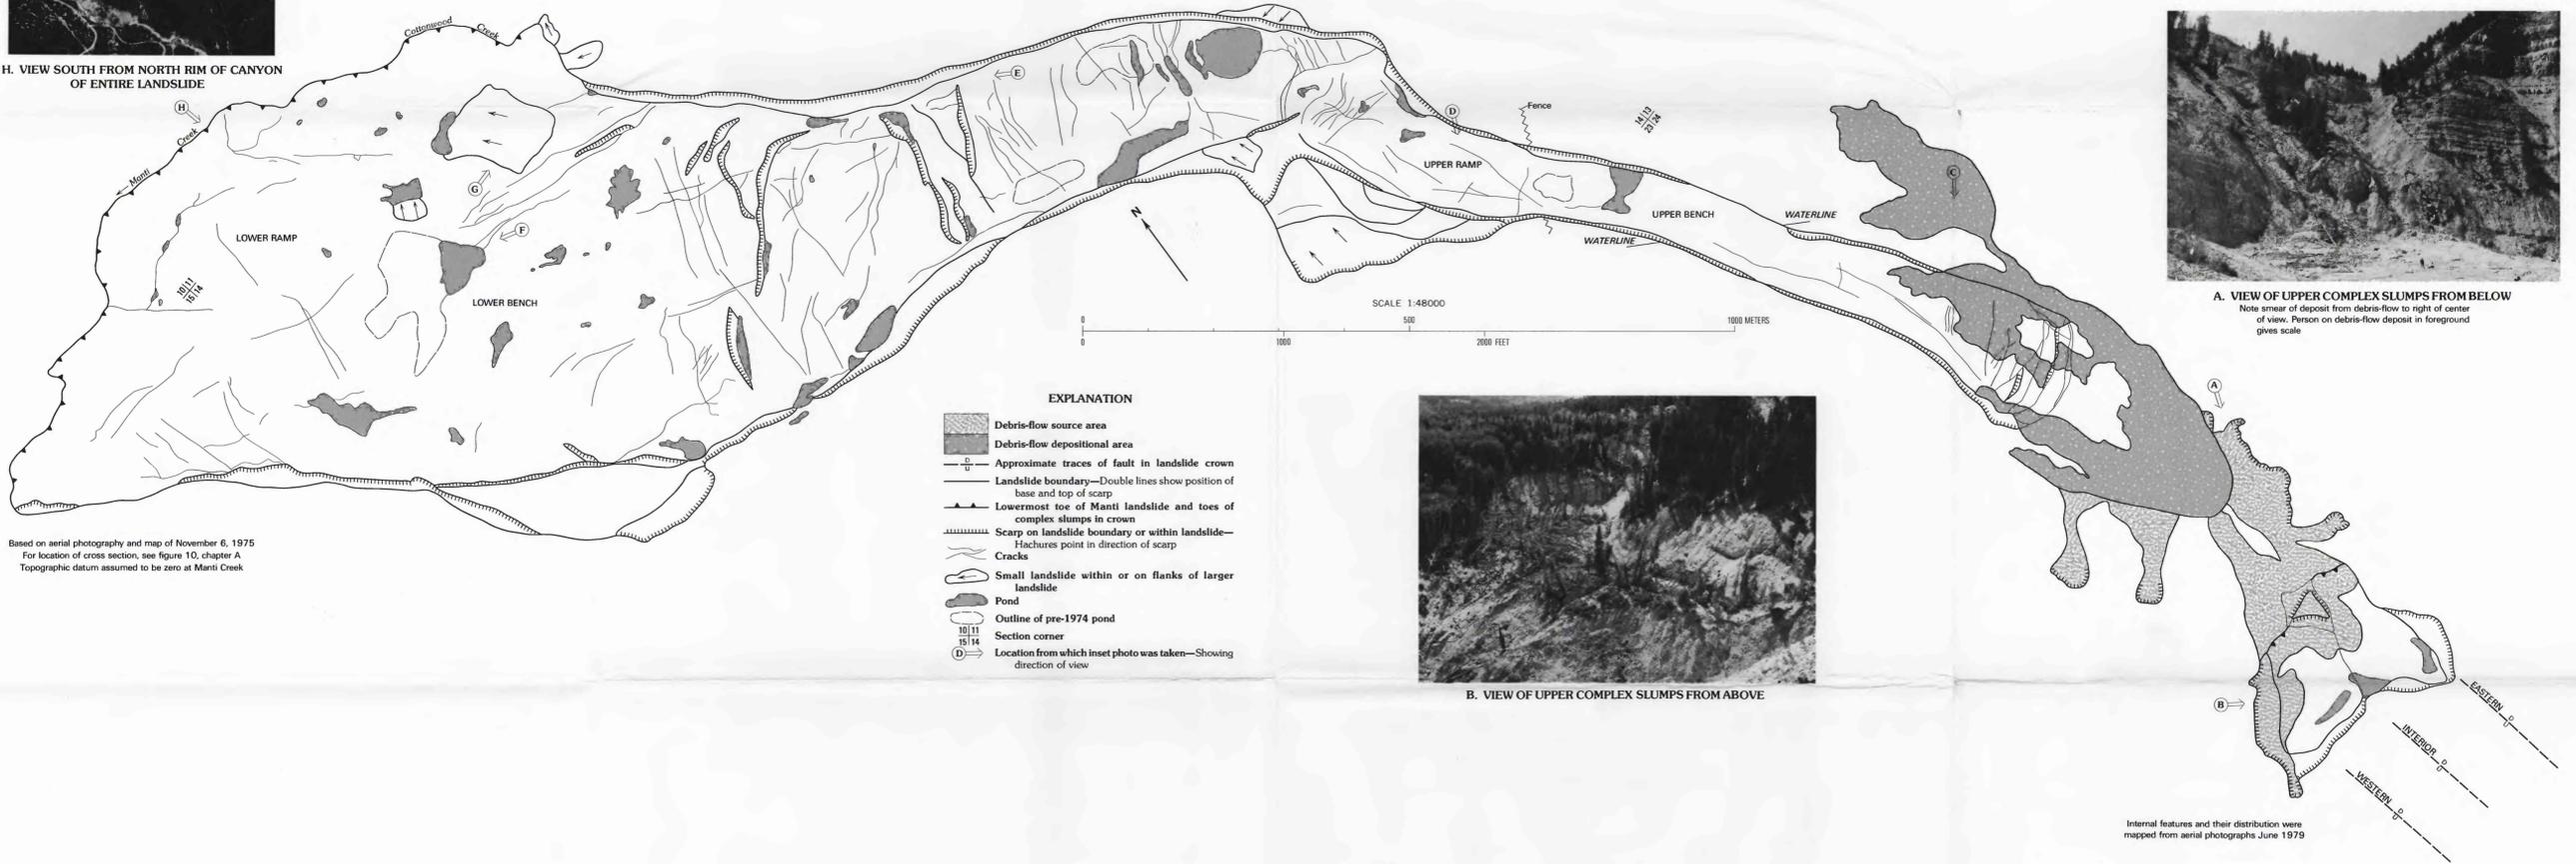


Based on aerial photography and map of November 6, 1975  
For location of cross section, see figure 10, chapter A  
Topographic datum assumed to be zero at Manti Creek



B. VIEW OF UPPER COMPLEX SLUMPS FROM ABOVE

Internal features and their distribution were mapped from aerial photographs June 1979

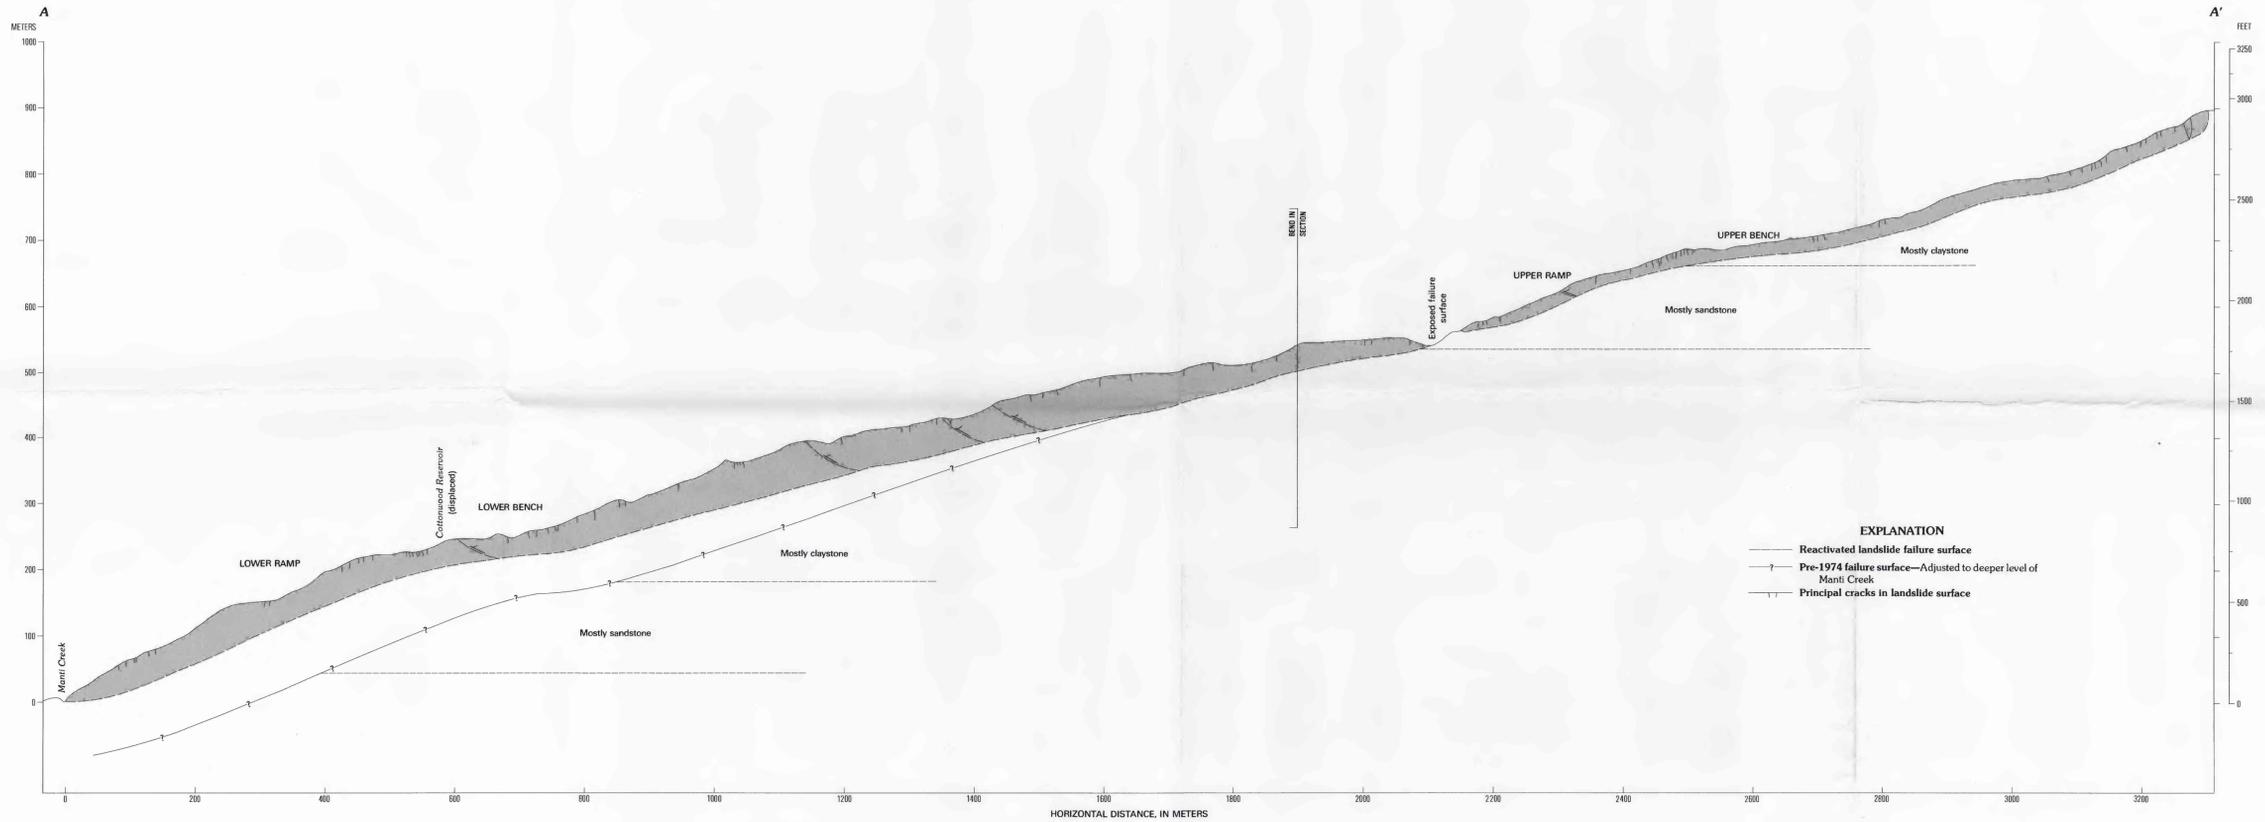

MAP AND CROSS SECTION OF MANTI LANDSLIDE